



DS 7 CROSSBACK: FX-479-CZ

Vinnumber:	VR1J4DGZUMY007459	Versionname:	DS DS 7 CROSSBACK E-TENSE 225 Business VP [5P] bva 8-225CH-10cv (SUV)
First Registrationdate:	12/02/2021	Fiscalpower:	
Expertise Mileage:	107902	Power Kw:	165
Bodytype:	SUV	Body colour:	Grey
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Front	Interior colour:	Dark Brown
Fueltype:	Plug-in hybrid	Type of rims (mounted):	Aluminium
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Category:	Passenger Car		

Options

Number of keys total	1	Radio	
Number keys remote	1	Central consol F	
GPS big screen color		Luggage cover	
Windows electric F		Headlights Xenon/LED/Laser	
Windows electric R		Front parking sensors	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Seat cover lining	Lining Other
Steering wheel leather			
Type of climate control	Autom climate control		

Tyres

235/50/19/103 W				
Summer tyres:	Fr.L.	Goodyear: 20%	Fr.R.	Goodyear: 25%
	Re.L.	Michelin: 45%	Re.R.	Michelin: 50%
Tyre profile depth FL				6.9
Tyre profile depth FR				6.7
Tyre profile depth RL				5.1
Tyre profile depth RR				5.0
Tyre size FL				235/50 R 19 103 W
Tyre size FR				235/50 R 19 103 W
Tyre size RL				235/50 R 19 99 W
Tyre size RR				235/50 R 19 99 W
Tyre type FL				All seasons
Tyre type FR				All Seasons
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				259
Tyre make FR				259
Tyre make RL				261
Tyre make RR				261

Assistance equipment

Interior covering B pillar L, Scratch(es), Replace





Inner door sill RL, Scratch(es), Paint



Remote ignition key (no insert), Missing, Repair/replace (lump sum)



Instrument panel cover, Broken, Replace



Headrest RR, Missing, Replace



Inner door sill RR, Scratch(es), Paint



Alloy rim FL bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Alloy rim FR bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Door FL, Dent(s), Repair and paint (complete)



Bumper F, Scratch(es), Paint



Bumper moulding FL, Unclamped, Dismount/Mount




Bumper moulding FR, Unclamped, Dismount/Mount




Daytime running light FR, Crack, Replace



Bumper moulding F, Broken, Replace

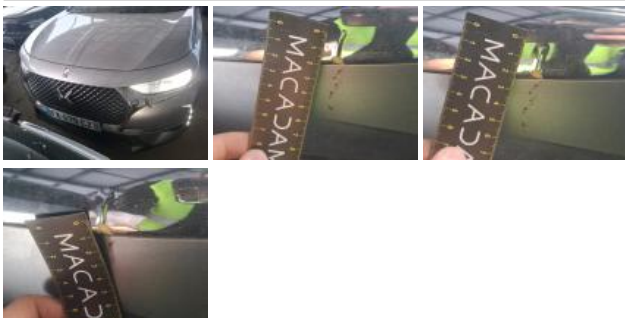

Wing RR, Dent(s), Repair and paint (complete)

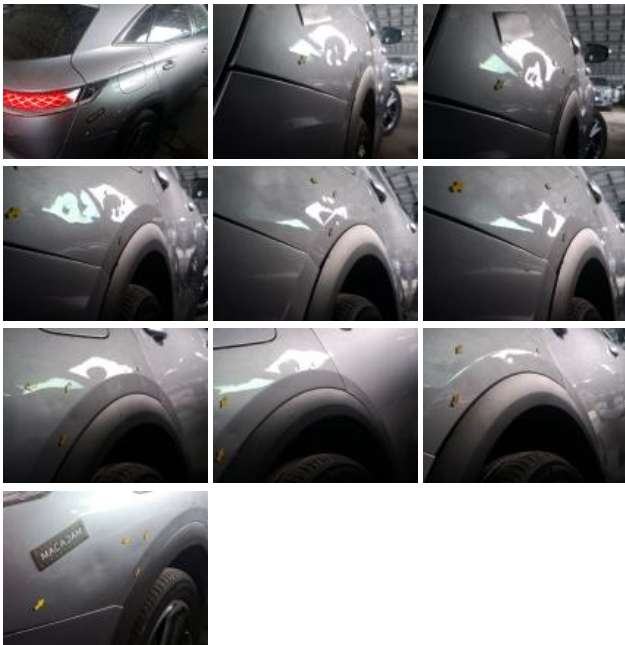

Door FR, Dent(s), Repair and paint (complete)



Charging cable (normal), Missing, Replace



Fog light RL, Broken, Replace



Roof, Dent(s), Repair and paint (complete)





Historique Maintenance

Immatriculation: **FX-479-CZ**

Date de 1ère immatriculation: **12/02/2021**

Modèle: **DS 7 CROSSBACK E-TENSE 225 Business VP [5P] bva 8-225CH-10cv (SUV)**

Date	Kilométrage	Fournisseur	Descriptif
22/12/2025	105.412	FLEET SOLUTIONS FRANCE	REPLACEMENT PNEUS 4 SAISONS
19/12/2024	81.325	FLEET SOLUTIONS FRANCE	REPLACEMENT PNEUS ETE
29/08/2023	56.007	EUROFLEET TYRES AND SERVICES	REPLACEMENT PNEUS ETE
23/08/2023	50.000	FRANCE AUTO	DISQUES PLAQUETTES AR RPLT
	0		REVISION ET CLIM ET AIR ET BOUGIES
	0		BALAIS ESSUIE GLACE AV AR
	0		PURGE CIRCUIT FREIN CTRL
	0		DISQUES PLAQUETTES AV RPLT