



DS 7 CROSSBACK: FE-740-GQ

Vinnumber:	VR1JCYZRKY034255	Versionname:	DS DS 7 CROSSBACK BlueHdi 130 Auto Executive VP [5P] bva 8-130CH-6cv (SUV)
First Registrationdate:	4/03/2019	Fiscalpower:	
Expertise Mileage:	104980	Power Kw:	96
Bodytype:	Off-road	Body colour:	Black
Gearbox:	Automatic	Paint type:	Metallic
Transmission:	Front	Interior colour:	Black
Fueltype:	Diesel	Type of rims (mounted):	Aluminium
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Category:	Passenger Car		

Options

Number of keys total	2	Radio	
Number keys remote	2	Central consol F	
GPS big screen color		Luggage cover	
Windows electric F		Headlights Xenon/LED/Laser	
Windows electric R		Front parking sensors	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Rear view camera	
Steering wheel leather		Seat cover lining	Lining Leather
Type of climate control	Autom climate control		

Tyres

235/55/18/104 V				
Summer tyres:	Fr.L.	Dunlop: 60%	Fr.R.	Dunlop: 55%
	Re.L.	Goodyear: 20%	Re.R.	Goodyear: 40%
Tyre profile depth FL				4.3
Tyre profile depth FR				4.5
Tyre profile depth RL				6.8
Tyre profile depth RR				5.7
Tyre size FL				235/55 R 18 104 V
Tyre size FR				235/55 R 18 104 V
Tyre size RL				235/55 R 18 104 V
Tyre size RR				235/55 R 18 104 V
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				All seasons
Tyre type RR				All Seasons
Tyre make FL				257
Tyre make FR				257
Tyre make RL				259
Tyre make RR				259

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Alloy rim FL bitone/polychrome, Scratch(es), Repair/replace (lump sum)






Alloy rim RL bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Alloy rim RR bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Alloy rim FR bitone/polychrome, Scratch(es), Repair/replace (lump sum)

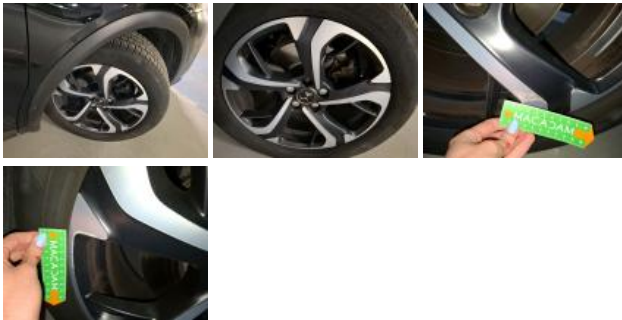

Bumper moulding FR, Unclassped, Dismount/Mount




Bumper moulding F, Bad repair, Paint



Wing trim FR, Scratch(es), Acceptable



Bumper moulding RL, Broken, Replace

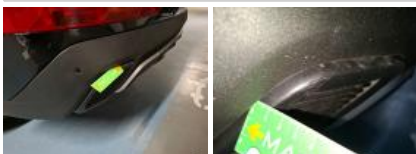

Bumper moulding RR, Scratch(es), Replace



Historique Maintenance

Immatriculation: FE-740-GQ Date de 1ère immatriculation: 04/03/2019

Modèle: DS 7 CROSSBACK BlueHDi 130 Auto Executive VP [5P] bva 8-130CH-6cv (SUV)

Date	Kilométrage	Fournisseur	Descriptif
24/02/2025	95.103	STELLANTIS &YOU FRANCE SAS	REVISION
	0		ADBLUE
	0		BALAI ESSUIE GLACE AV
	0		BALAI ESSUIE GLACE AR
	0		COURROIE ACCESSOIRES RPLT
	0		DIVERS CLIM
	0		LIQUIDE DE FREIN
	0		FILTRE CLIM RPLT
20/02/2024	90.192	STELLANTIS &YOU FRANCE SAS	RECYCLAGE
	0		REVISION
	0		DIVERS CLIM
	0		DISQUES PLAQUETTES AR RPLT
	0		BALAI ESSUIE GLACE AR
	0		BALAI ESSUIE GLACE AV
02/08/2023	84.562	STELLANTIS &YOU FRANCE SAS	TELECHARGEMENT CALCULATEUR
30/01/2023	82.688	STELLANTIS &YOU FRANCE SAS	BALAI ESSUIE GLACE AR
	0		BALAI ESSUIE GLACE AV
	0		DISQUES PLAQUETTES AV RPLT
	0		RECYCLAGE
	0		LIQUIDE DE FREIN
	0		FILTRE CLIM RPLT
	0		DIVERS CLIM
	0		REVISION
19/01/2022	77.663	STELLANTIS &YOU FRANCE SAS	REVISION
	0		ADBLUE
21/12/2021	76.352	NORAUTO SAS (PRODUIT SPE)	REMPLACEMENT PNEUS 4 SAISONS
15/12/2021	58.025	TRUJAS PARIS EST	DIVERS ECHAPPEMENT
28/06/2021	58.025		DISQUES PLAQUETTES AR RPLT
	0		PLAQUETTES AV RPLT
	0		BALAI ESSUIE GLACE AV AR
	0		REVISION ET CLIM ET AIR ET CARBURANT
27/07/2020	11.217	STELLANTIS &YOU FRANCE SAS	BALAI ESSUIE GLACE AV

Historique Maintenance

Immatriculation: **FE-740-GQ**

Date de 1ère immatriculation: **04/03/2019**

Modèle: **DS 7 CROSSBACK BlueHDi 130 Auto Executive VP [5P] bva 8-130CH-6cv (SUV)**

Date	Kilométrage	Fournisseur	Descriptif
	0		TLG POUBELLE
	0		REVISION
	0		PLAQUETTES AV RPLT