



Expertise

Protocol number: 46463660
Order No. / Reference: 26494589
Inspection date: 10 Jul 2026

Manufacturer: Volvo

Model: XC90 B5 D AWD Geartronic RDesign

VIN: YV1LCK2UCM1726369



Vehicle details

Manufacturer / Type / Model / Equipment

Volvo XC90 B5 D AWD Geartronic RDesign

Vehicle Identification number YV1LCK2UCM1726369
Mileage (Read) 97,144 km
First registration 18 Jan 2021
Number of holders 1
Next periodical technical inspection 02/2028
(Report on hand)

Power / Engine displacement 173 kw / 1,969 ccm
Fuel type / Cylinder Hybrid Diesel / E / 4
Gearbox / Number of gears Automatic / 8
Type of drive All-wheel drive
Type of vehicle SUV

Colour / colour code Ice White
Doors / Seats 5 / 5
Upholstery type Cloth / leather combination
Colour of upholstery Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	206 Tag(e)
Last service on / at	02/2026 at 87,989 km		
Key is / should be	3 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GA545716
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	With complaint
Manufacturer key number/ type code number	9101 / BPR 00060		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,670 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	275/35 R22 104Y	Summer tyres on Light alloy	Goodyear	5mm / 5mm
2)	275/35 R22 104Y	Summer tyres on Light alloy	Goodyear	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 103H	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	235/60 R18 103H	Winter tyres on Light alloy	Pirelli	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 12/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- ABS - Anti-lock Braking System
- Passenger side airbag can be deactivated
- Airbag, driver's knee airbag
- Active safety belts with belt tensioners (for all occupants)
- All-wheel drive (AWD)
- Applications on the side windows in high-gloss black
- Attention warning
- Exhaust system with two chrome-plated tailpipes
- Outdoor temperature display
- Hill Start Assist (HSA)
- LED turn signals integrated into the exterior mirrors
- Brake energy recuperation
- Brake lights, adaptive
- CleanZone air quality system with activated carbon filter
- Anthracite headliner
- Roof spoiler
- Digital Instrumentation
- Drive Mode (driving mode settings for engine, transmission, steering, brakes and suspension)
- Electronic differential lock
- Electronic stability control
- Automatic emergency braking
- Cruise control
- Seat belt height adjustment front and rear (2nd row of seats)
- Rear window wiper with intermittent function
- Interior lighting
- IntelliSafe Assistant
- Keyless Drive (electronic access system with sensor-controlled tailgate, waterproof micro key and illuminated door handles and puddle lights)
- Headrests of the 2nd row of seats can be folded down (electrically)
- Cargo area roller blind (semi-automatic)
- LED headlights "Thor's Hammer" with high beam assist and integrated LED daytime running lights
- Steering wheel: Multifunction buttons on the steering wheel
- Illuminated makeup mirror for driver and front passenger
- Model and engine emblem on the rear
- Oncoming Lane Mitigation
- Electric parking brake
- Upholstery: Nubuck textile/Nappa leather, sports seats
- Radio accessories: Smartphone integration Apple CarPlay and Android Auto
- Rain sensor
- Road Edge Detection
- Run-off Road Protection
- Rear bench seat of the 2nd row in a 40/20/40 ratio or completely foldable
- Safety braking system with disc brakes all around (internally ventilated)
- Seats: Electrically adjustable driver's seat (8-way)
- Driver and passenger side airbags with two-stage deployment system
- Airbag, side airbags for driver and front passenger and head/shoulder airbags (iC) for all occupants
- Ambient lighting
- Dashboard and door trim in leather look with contrasting stitching
- Electrically adjustable, foldable and heated exterior mirrors
- Hill Descent Control (HDC)
- Fog sensor for automatic activation of the defroster function
- On-board computer
- third brake light
- City Safety
- Connected Safety
- Roof rails in high-gloss black (integrated)
- Diesel particulate filter
- Tachometer
- Rear parking assist
- Aluminum door sill plates with Volvo lettering at the front (illuminated) and rear
- Electric windows front and rear
- Luggage compartment partition net
- Transmission: 8-speed Geartronic automatic transmission
- Automatic tailgate
- Heated rear window
- Interior and exterior mirrors automatically dimming
- Intelligent driver information system
- ISOFIX mount
- Keyless Start
- Child lock
- Automatic climate control with separate temperature control for driver and passenger side
- Front headrests
- LED fog lights with cornering function
- Leather gearshift lever, sport
- Steering wheel adjustable for height and reach
- Steering wheel: Sport leather steering wheel
- Front center armrest including cup holder
- Sensus navigation system
- Package: Winter Package
- Pollen filter
- Radio accessories: Digital radio reception (DAB+)
- Radio accessories: Two USB-C ports on the back of the center console
- Tire pressure monitoring system
- Road Sign Information (RSI) - Traffic Sign Recognition
- Wheels: Tire sealant
- Heated windshield washer nozzles
- Speed-sensitive power steering
- Seats: Front passenger seat electrically adjustable (8-way)



- Seats: Lumbar support (4-way electrically adjustable) for driver and front passenger seats
- Sun blinds for the rear side windows (integrated)
- Sport front and rear apron
- Sport pedals
- Start/Stop technology
- First aid kit and warning triangle
- Lashing eyes in the luggage compartment (foldable)
- Preparation for Trailer Stability Assist (TSA)
- WHIPS whiplash protection system

- Seats: Adjustable (electric) leg rest for driver and front passenger seats
- Seats: Memory function for passenger seat
- Seats: Rear seat backrests in a 60/40 ratio or fully foldable
- Sport exterior mirrors in high-gloss black
- Sport front grille with horizontal struts and surround in high-gloss black
- Power socket
- Glazing: Colored glazing
- Volvo On Call with Wi-Fi hotspot
- Immobiliser
- Central locking system with two remote controls and integrated emergency key

Extra equipment

- Alarm system (with motion/tilt sensor, safety locking and private locking (separate glove compartment and trunk locking))
- IntelliSafe Surround (Blind Spot Information System (BLIS) - Cross Traffic Alert (CTA) - Rear Impact Mitigation)
- Package: Xenium Package Pro (Automatic climate control with 4-zone temperature control - Panoramic glass sunroof with tilt function and integrated, continuously adjustable sunshade (electric) - Head-up display, graphic projection of driving information onto the windshield - Parking camera with 360° surround view - Front and rear parking sensors - Sensus Connect infotainment system with HIGH PERFORMANCE SOUND PRO by Harman Kardon - Enhanced air quality system with fine dust filtration according to PM2.5 air quality standard)
- Wheels: 22" alloy wheels, 6-twin-spoke design, diamond cut/graphite look (with 275/35 R 22 tires - 9 x 22" rims)

- Parking assistance, front and rear
- Head-up display: Graphic projection of driving information onto the windshield
- Package: Winter Package Pro (auxiliary heater with timer (fuel-operated) in conjunction with Volvo On Call remote activation via smartphone app - rear seat heating (outer seats of the 2nd row))
- Radio: Sensus Connect infotainment system with premium sound by Harman Kardon (9" touchscreen (22.9 cm diagonal) - 600 watts of power - 14 speakers - Fresh Air subwoofer - USB port (compatible with Apple iPod/iPhone/iPad) - Bluetooth hands-free system including audio streaming - Internet access including internet radio and apps (via paired smartphone) - Voice control - Digital vehicle owner's manual - Connected Service Booking)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed, problem has been detected This is due to the following reason.: Motorkontrolle



Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
2	Wheel / tyres	Alloy rim - front right side - Scratched - Loss in value
3	Instrument panel	Indicator light (Motorkontrollleuchte) - on - Perform diagnosis
4	Rear bumper	Rear bumper - Scratch(es) - Paint
5	Vehicle glazing	Windscreen - Broken / torn - Replace

Wear and tear

No.	Component group	Description
1	Interior	Interior - Scratch(es) - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Front bumper	Front bumper - Stone chips - No deduction
4	Sill - left side	Sill - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

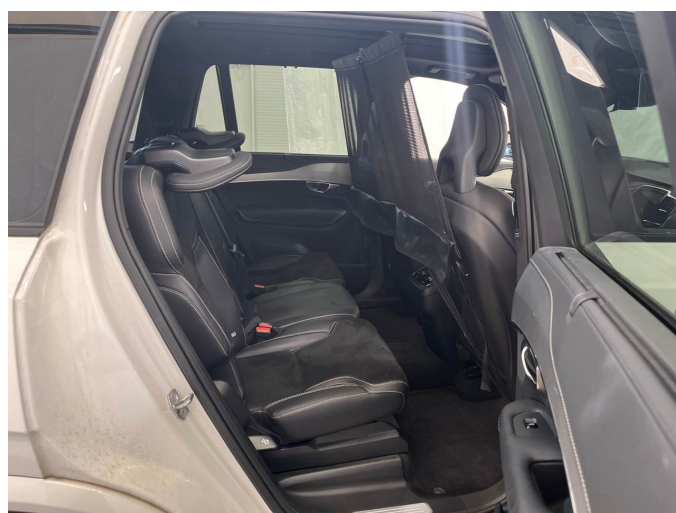


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

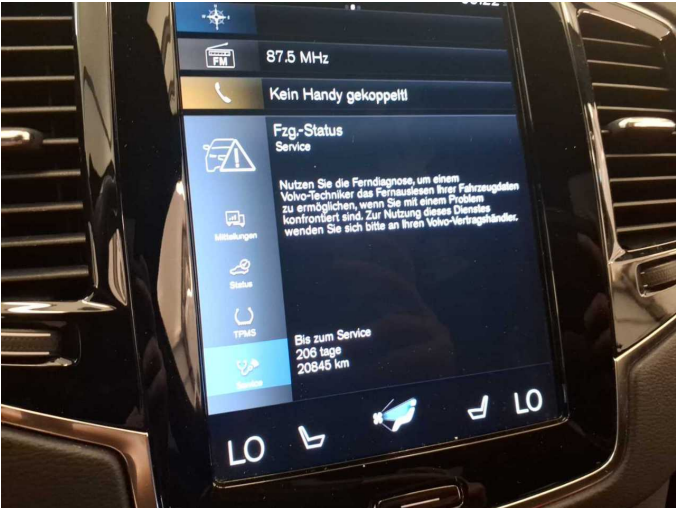


Figure 13: Documents



Figure 14: Documents

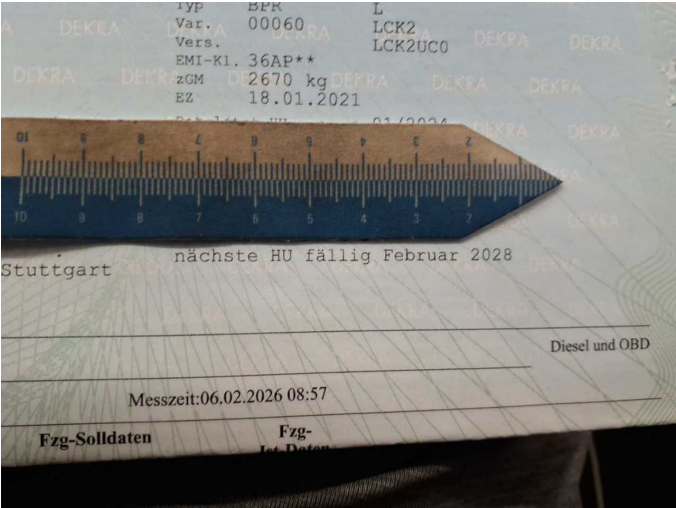


Figure 15: Documents

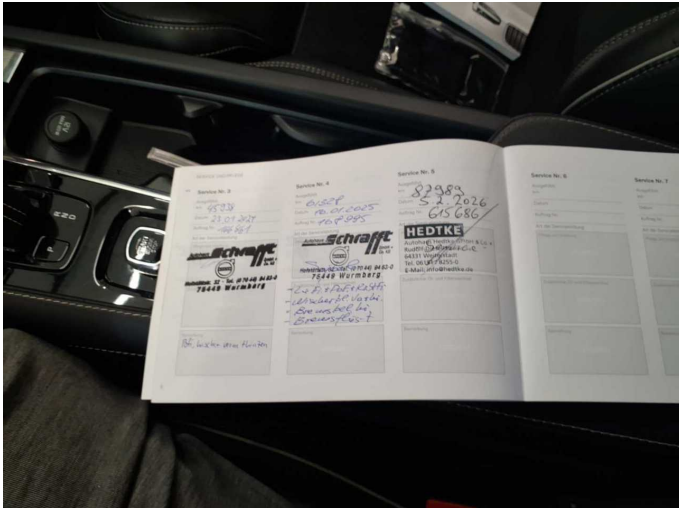


Figure 16: Documents

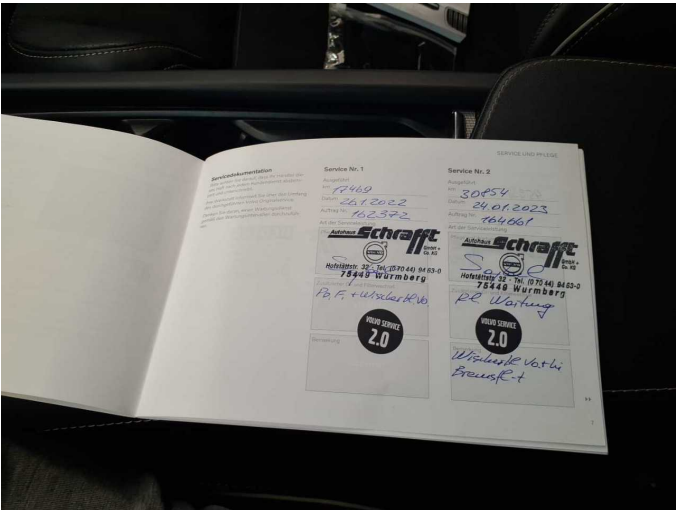


Figure 17: Documents



Figure 18: Additional tyres

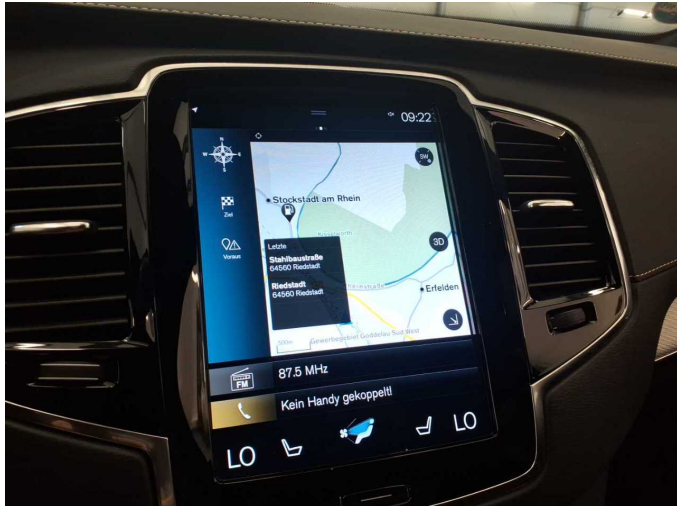


Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

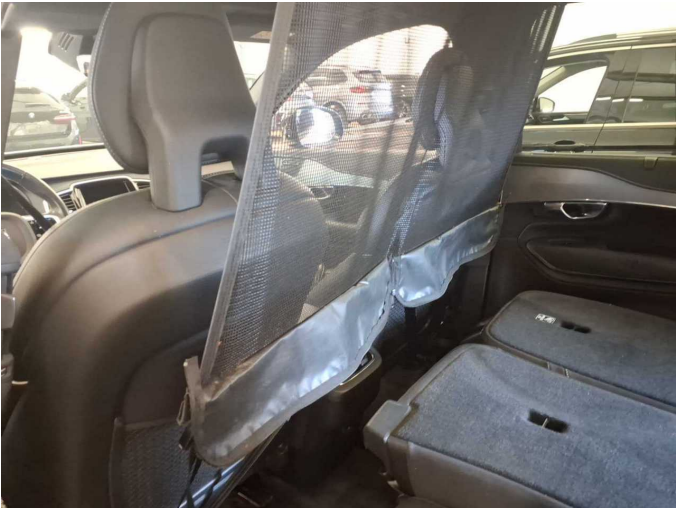


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.



Figure 38: Misc.



Figure 39: Misc.



Figure 40: Misc.



Figure 41: Misc.

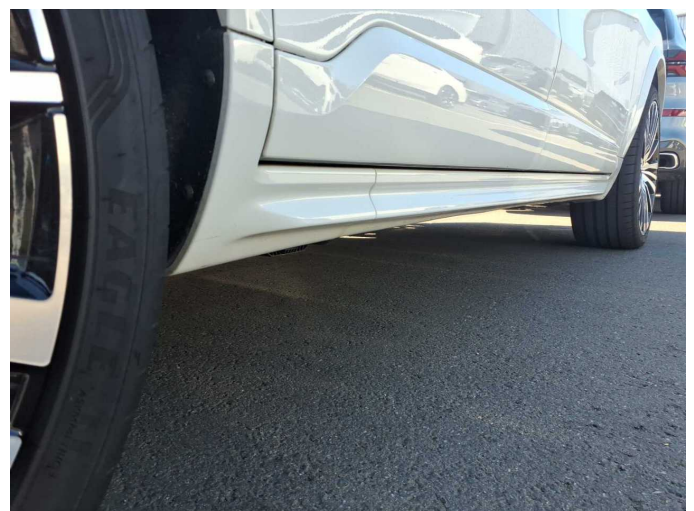


Figure 42: Misc.



Damage 1: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 1: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 1: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 2: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 2: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 3: Instrument panel: Indicator light (Motorkontrollleuchte) - on - Perform diagnosis



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 5: Vehicle glazing: Windscreen - Broken / torn - Replace



Damage 5: Vehicle glazing: Windscreen - Broken / torn - Replace



Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 3: Front bumper: Front bumper - Stone chips - No deduction



Wear and tear 3: Front bumper: Front bumper - Stone chips - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: YV1LCK2UCM1726369

Hersteller / Modell: VOLVO VOLVO XC90 B5 D AWD Geartronic RDesign

Datum	KM-Stand	Beschreibung
06.02.2026	87.989	HU + AU; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
16.01.2025	61.336	Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Systemtest/Eigendiagnose; Wartung Sonstiges
23.01.2024	45.945	AU; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
24.01.2023	30.861	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
26.01.2022	17.479	Kleine Inspektion; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges