



Expertise

Protocol number: 46163653
Order No. / Reference: 26345289
Inspection date: 25 Jun 2026

Manufacturer: Skoda
VIN: TMBJJ7NS7N8008061

Model: Kodiaq 2.0 TDI DSG Clever



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Kodiaq 2.0 TDI DSG Clever	
Vehicle Identification number	TMBJJ7NS7N8008061
Mileage (Read)	125,901 km
First registration	11 Nov 2021
Number of holders	1
Next periodical technical inspection	12/2026
(Report not on hand)	
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Brillant-Silber Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	17,400 km
Last service on / at	03/2026 at 119,066 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GD088347
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / ART 02405		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,247 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 99V	Summer tyres on Light alloy	Pirelli	4mm / 4mm
2)	235/50 R19 99V	Summer tyres on Light alloy	Pirelli	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	215/65 R17 99H	Winter tyres on Light alloy	Pirelli	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartment on the left wheel arch
- Storage compartments
- Removable waste bin for the door panel
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Extended warranty for 3 years, max. 50,000 km
- Traction control (ASR)
- Electrically folding exterior mirrors including interior and exterior mirrors with automatic dimming.
- Hill start assist
- Care Connect: Proactive services (10-year term)
- Roof rails, black
- Anti-theft alarm system
- Tachometer
- eCall
- Electronic parking brake including auto-hold function
- ESC Electronic Stability Control
- Electric windows front and rear
- front and rear floor mats
- Transmission: 7-speed dual-clutch transmission (DSG)
- Green tec (Start/Stop automatic including brake energy recuperation)
- Aero rear window wiper including windshield washer system
- Kessy - keyless entry and start-stop system
- Boot cover, roll-up and removable
- LED ambient lighting
- LED taillights
- Steering wheel: Leather steering wheel with multifunction buttons
- Front center armrest, including storage compartment
- MSR (Motor drag torque control)
- Fog lights with integrated LED daytime running lights
- Package: Family
- Front and rear parking sensors
- Radio: Amundsen infotainment system (Clever)
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Wireless SmartLink
- Tire pressure monitoring
- Rear seat backrest split 60:40, foldable, longitudinally adjustable, backrest angle adjustable
- Electromechanical power steering
- Seats: Heated front and outer rear seats
- Skoda Care Connect
- Sunshade roller blind for the rear side windows
- Bumpers painted in body color
- Telephone: Convenient hands-free telephone system including phone box
- Immobiliser
- Storage compartments behind the wheel arches in the trunk
- Airbag, driver and passenger
- Airbag, head airbags
- Allergen filter
- Anti-lock braking system (ABS)
- Traveller Plus Assistance System (DSG)
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Hydraulic brake assist
- Cargo elements in the trunk
- Clever decorative inlay
- Diesel particulate filter
- Third brake light
- Electric tailgate operation including comfort opening
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor
- Front radar assistant including city emergency braking function with pedestrian detection
- Tinted windows
- Illuminated glove compartment
- Heated rear window
- Rear spoiler
- ISOFIX preparation on the outer rear seats
- Climatronic air conditioning (2-zone)
- Front and rear headrests are height-adjustable.
- LED headlights with LED daytime running lights
- Steering wheel: Heated sports leather steering wheel with multifunction buttons
- Rear center armrest with cup holders and pass-through option
- Multifunction display in the instrument cluster, color
- Network program in the trunk
- Park Assist 3.0
- Upholstery: Cloth
- Radio accessories: 8 speakers
- Radio accessories: SmartLink
- Tire Mobility Kit
- Wheels: 19" Aronia AERO Platinum alloy wheels
- Heated windshield washer nozzles
- Headlights washer / wiper system
- Kodiaq seat belts
- Seats: Driver and passenger seats are height-adjustable
- Skoda Infotainment Online
- 12V socket - in the center console and in the trunk
- Sunset
- Variable fastening concept in the boot (only for 5-seaters)
- Lashing eyes in the trunk
- Central locking with remote control



Extra equipment

- Option to opt out of standard extended warranty
- Paint finish: Metallic
- Luggage net partition
- Electric panoramic sunroof including sunshade (no glasses compartment in the headliner)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Boot lid - Glued / labelled - De-glue / neutralise
2	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value
3	Door - rear right side	Door - Deformed - Repair and paint
4	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint
5	Side panel - rear left side	Side panel - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Repainting

No.	Repainting
1	Bonnet, Professionally carried out, Invoice of repair done Non-existent

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.

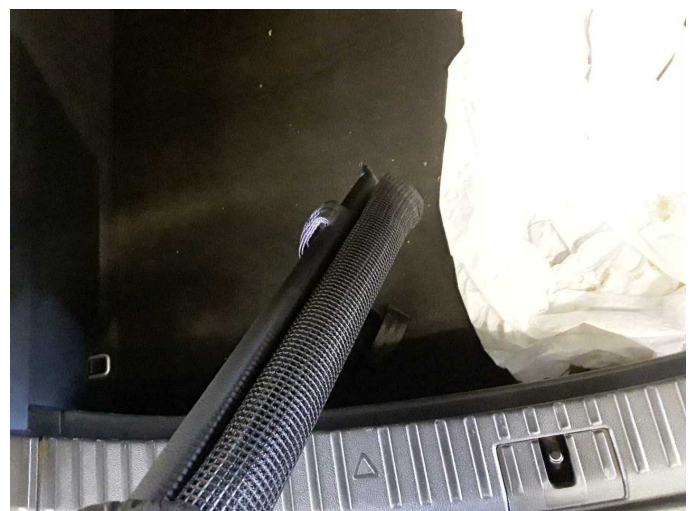


Figure 18: Misc.

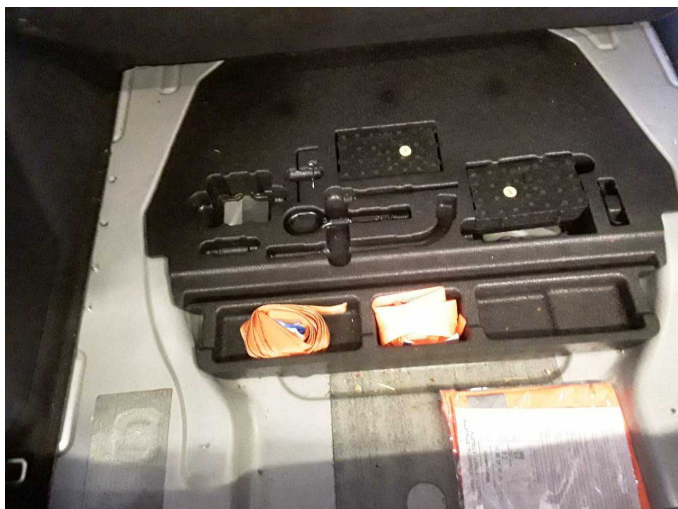


Figure 19: Misc.



Figure 20: Misc.

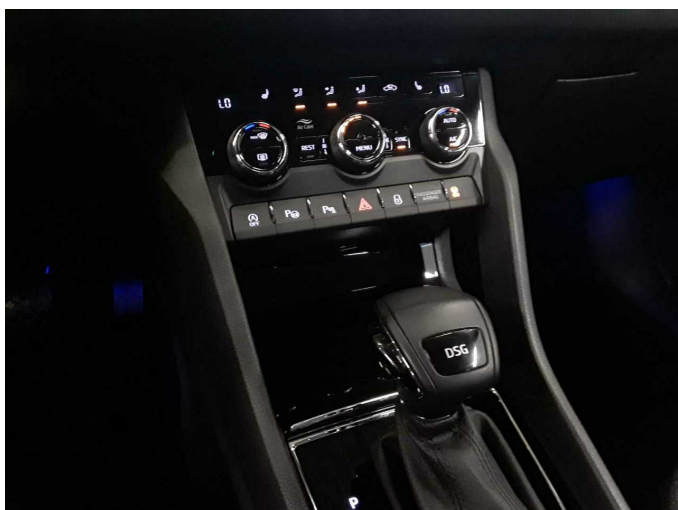


Figure 21: Misc.



Figure 22: Misc.

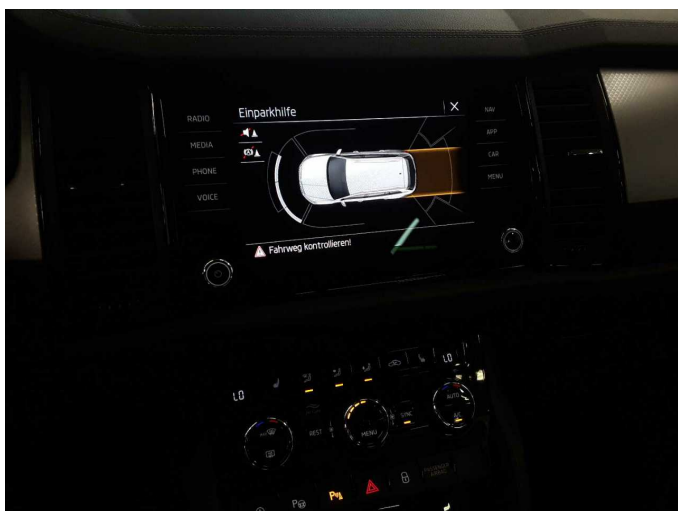


Figure 23: Misc.

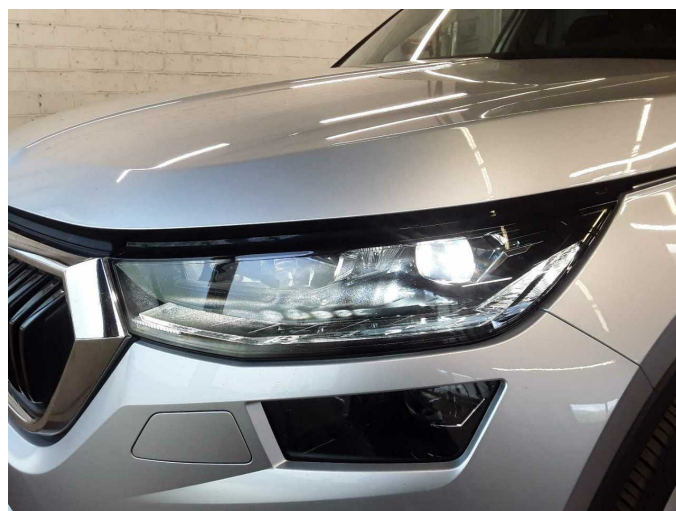


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

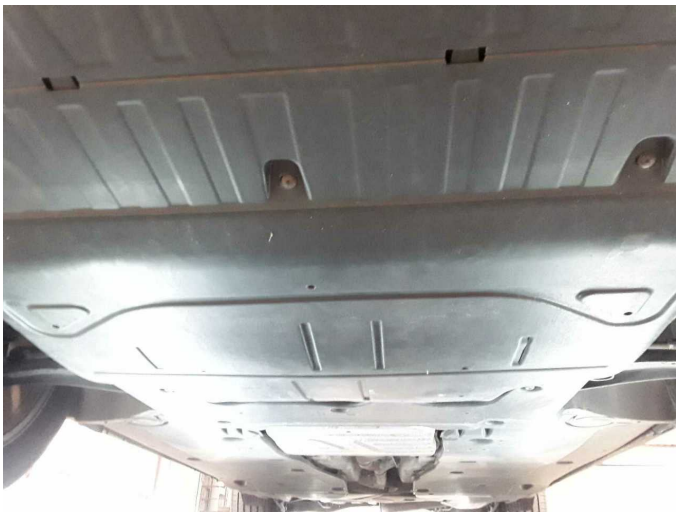


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Damage 1: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise



Damage 1: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise



Damage 2: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 2: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 3: Door - rear right side: Door - Deformed - Repair and paint




Damage 3: Door - rear right side: Door - Deformed - Repair and paint



Damage 3: Door - rear right side: Door - Deformed - Repair and paint



Damage 4: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

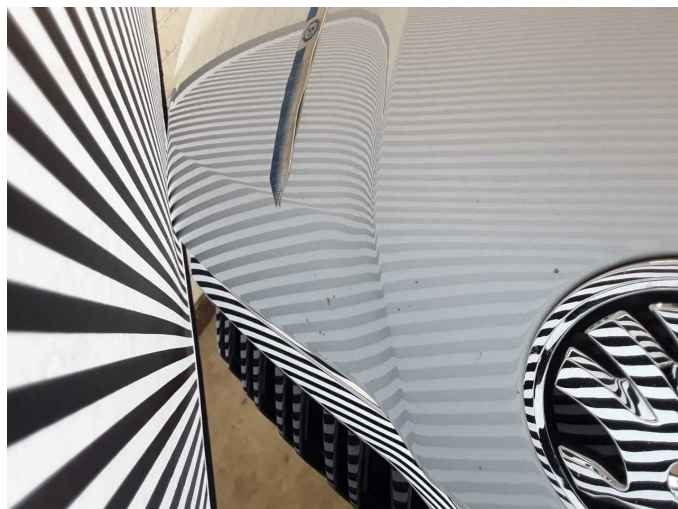

Damage 4: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 4: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 5: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 5: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint




Wear and tear 1: Front bumper: Front bumper - Stone chips - No deduction



Wear and tear 1: Front bumper: Front bumper - Stone chips - No deduction



Wear and tear 2: Vehicle glazing: Windscreen - Stone chips - No deduction

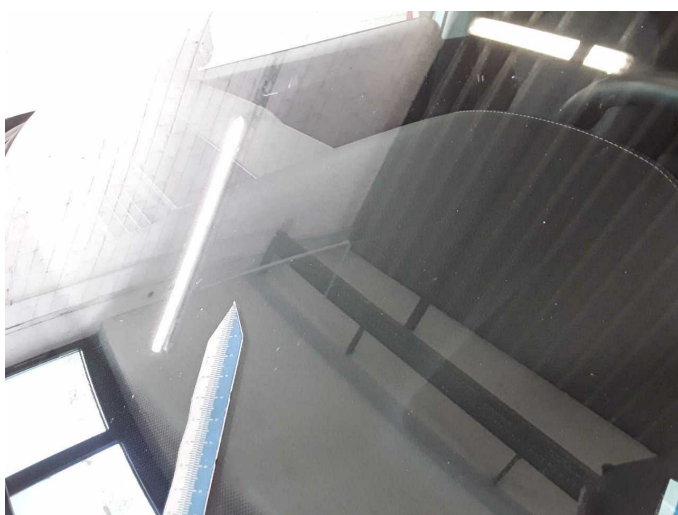

Wear and tear 2: Vehicle glazing: Windscreen - Stone chips - No deduction



Repainting 1: Bonnet



Repainting 1: Bonnet



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJJ7NS7N8008061
Hersteller / Modell: SKODA SKODA Kodiaq 2.0 TDI DSG Clever

Datum	KM-Stand	Beschreibung
09.03.2026	119.066	Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Regelwartungsdienst; Wartung Sonstiges
14.01.2026	113.870	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
12.12.2025	108.557	Reparatur Sonstiges; Systemtest/Eigendiagnose; Zahnriemen/Steuerkett ern
02.05.2025	89.607	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
30.01.2025	83.147	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
13.12.2024	76.398	AU; Reparatur Sonstiges
02.10.2024	74.262	Batterie ern; Keilrippenriemen; Lichtmaschine ern/inst; Systemtest/Eigendiagnose; Wartung Sonstiges
26.04.2024	60.106	Regelwartungsdienst; Wartung Sonstiges
21.03.2024	53.899	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
19.10.2023	41.915	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsscheiben hinten; Wartung Sonstiges
27.03.2023	30.084	Regelwartungsdienst
23.12.2022	24.498	Motoröl b. Wartung; Ölwechsel