



RENAULT MEGANE SOCIÉTÉ: FR-386-FY

Vinnumber:	VF1RFB00X65602965	Versionname:	RENAULT MEGANE SOCIÉTÉ Air Nav 2P
First Registrationdate:	8/07/2020	Fiscalpower:	Blue dCi 95 VF [5P] 6-95CH-5cv (bi-corps VU)
Expertise Mileage:	113256	Power Kw:	70
Bodytype:	Berline	Body colour:	White
Gearbox:	MAN 6 VIT	Paint type:	Opaque
Transmission:	Front	Interior colour:	Black
Fueltype:	Diesel	Type of rims (mounted):	Steel
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Steel		
Category:	VS		

Options

Number of keys total	1	Radio	
Number keys remote	1	Central consol F	
GPS big screen color		Luggage cover	
Windows electric F		Rear parking sensors	
Cruise Control		Seat cover lining	
Steering wheel multifunctional			Lining Other
Steering wheel leather			Lining Semi-leather
Type of climate control	Autom climate control		

Tyres

	205/55/16/91 V			
Summer tyres:	Fr.L.	Continental: 35%	Fr.R.	Continental: 35%
	Re.L.	Continental: 50%	Re.R.	Continental: 45%
Tyre profile depth FL	6.0			
Tyre profile depth FR	6.0			
Tyre profile depth RL	4.8			
Tyre profile depth RR	5.2			
Tyre size FL	205/55 R 16 91 V			
Tyre size FR	205/55 R 16 91 V			
Tyre size RL	205/55 R 16 91 V			
Tyre size RR	205/55 R 16 91 V			
Tyre type FL	Summer			
Tyre type FR	Summer			
Tyre type RL	Summer			
Tyre type RR	Summer			
Tyre make FL	256			
Tyre make FR	256			
Tyre make RL	256			
Tyre make RR	256			

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Remote ignition key, Missing, Repair/replace (lump sum)



Gear shift lever cover, Tear, Replace



Interior, Stain, Cleaning



Floor mat F, Tear, Replace



Wheel cover FR, Broken, Replace



Wing FL, Dent(s), Repair and paint (complete)



Door FL, Dent(s), Repair and paint (complete)




Door RL, Dent(s), Repair and paint (complete)



Roof pillar L, Dent(s), Repair and paint (complete)



Wing RL, Dent(s), Repair and paint (complete)

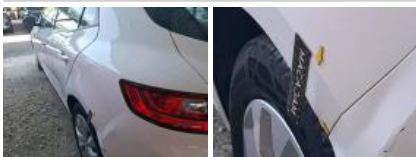

Bumper F, Scratch(es), Paint



Fog lamp R, Unclassped, Dismount/Mount



Fog lamp L, Unclassped, Dismount/Mount



Bonnet, Dent(s) and scratch(es), Repair and paint (complete)



Wing RR, Dent(s) and scratch(es), Repair and paint (complete)



Door RR, Dent(s) and scratch(es), Repair and paint (complete)



Outside rear-view mirror housing R, Scratch(es), Paint



Bumper R, Deformed / Strained, Replace and paint



Rubber seal for boot lid, Tear, Replace



Luggage cover cord, Incomplete, Replace



Roof, Dent(s), Repair and paint (complete)



Historique Maintenance

Immatriculation: **FR-386-FY** Date de 1ère immatriculation: **08/07/2020**

Modèle: **Renault MÉGANE SOCIÉTÉ Air Nav 2P Blue dCi 95 VF [5P] 6-95CH-5cv (bi-corps VU)**

Date	Kilométrage	Fournisseur	Descriptif
20/05/2026	102.550	RRG BORDEAUX MAYE VILLENAVE D ORMON	REPLACEMENT PNEUS ETE
24/10/2025	91.289	RENAULT RETAIL GROUP	LAMPE CODE AVD RPLT
	0		LEVE VITRE AVG RPLT
29/07/2025	85.739	RENAULT RETAIL GROUP	BALAI ESSUIE GLACE AR
	0		BALAI ESSUIE GLACE AV
	0		REVISION ET CLIM
	0		DISQUES PLAQUETTES AV RPLT
	0		RECYCLAGE
	0		DISQUES PLAQUETTES AR RPLT
06/05/2025	77.088	RENAULT RETAIL GROUP	TELECHARGEMENT CALCULATEUR
	0		ESSAI
	0		DIVERS ECHAPPEMENT
09/04/2025	74.920	RENAULT RETAIL GROUP	REVISION
	0		LIQUIDE DE REFROIDISSEMENT RPLT
	0		RECYCLAGE
03/05/2024	55.380	GARAGE DU LAC	SERENITE
	0		RECYCLAGE
	0		PLAQUETTES AV RPLT
	0		BALAI ESSUIE GLACE AR
	0		BALAI ESSUIE GLACE AV
	0		LIQUIDE DE FREIN
28/11/2022	34.200	GARAGE DU LAC	RECYCLAGE
	0		BALAI ESSUIE GLACE AV AR
	0		REVISION ET CLIM
17/10/2022	34.028	NORAUTO SAS (PRODUIT SPE)	PLAQUETTES AR RPLT
	0		PLAQUETTES AV RPLT
17/10/2022	34.028	NORAUTO SAS (PRODUIT SPE)	JANTE RPLT
17/10/2022	34.028	NORAUTO SAS (PRODUIT SPE)	REPLACEMENT PNEUS ETE
27/10/2021	5.168	GARAGE DU LAC	RECYCLAGE
	0		SERENITE