



Expertise

Protocol number: 46541884  
Order No. / Reference: 26472265  
Inspection date: 15 Jul 2026

Manufacturer: Volvo

Model: XC60 T6 AWD Recharge Plus Bright

VIN: LYVUZH1V2PB281604



| Vehicle details                         |                       |
|-----------------------------------------|-----------------------|
| Manufacturer / Type / Model / Equipment |                       |
| Volvo XC60 T6 AWD Recharge Plus Bright  |                       |
| Vehicle Identification number           | LYVUZH1V2PB281604     |
| Mileage (Read)                          | 121,791 km            |
| First registration                      | 10 Feb 2023           |
| Number of holders                       | 1                     |
| Next periodical technical inspection    | 01/2028               |
| (Report on hand)                        |                       |
| Power / Engine displacement             | 186 kw / 1,969 ccm    |
| Fuel type / Cylinder                    | Hybr.B/E ext.aufl / 4 |
| Gearbox / Number of gears               | Automatic / 8         |
| Type of drive                           | All-wheel drive       |
| Type of vehicle                         | SUV                   |
| Colour / colour code                    | Onyx Black Metallic   |
| Doors / Seats                           | 5 / 5                 |
| Upholstery type                         | Leather               |
| Colour of upholstery                    | White                 |
| Re-import                               | no                    |
| readiness to drive                      | Roadworthy            |



## Vehicle details

|                                                  |                              |                                |                                                            |
|--------------------------------------------------|------------------------------|--------------------------------|------------------------------------------------------------|
| <b>Maintenance booklet / proof</b>               | digital proof / complete     | <b>Next maintenance in</b>     | 6,964 km                                                   |
| <b>Last service on / at</b>                      | 01/2026 at 98,754 km         |                                |                                                            |
| <b>Key is / should be</b>                        | 3 / 3                        | <b>FZG documents</b>           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                                  |                              | <b>Letter No.</b>              | GQ216504                                                   |
| <b>Previous damage / Accident</b>                | None detectable              | <b>Repainting</b>              | Detectable                                                 |
| <b>Inspection conditions</b>                     | sufficient                   | <b>Lifting equipment / pit</b> | No                                                         |
| <b>Test drive</b>                                | Not performed                | <b>Engine function test</b>    | Performed                                                  |
| <b>readiness to drive</b>                        | Roadworthy                   |                                |                                                            |
| <b>Manufacturer key number/ type code number</b> | 9101 / BRS 00017             |                                |                                                            |
| <b>Emission standard</b>                         | EURO6;WLTP;AP;PI/CI; M, N1 I | <b>fine dust sticker</b>       |                                                            |
| <b>Permitted total weight</b>                    | 2,660 kg                     | <b>Empty weight</b>            |                                                            |

## Tyres

### Mounted tyres

| #  | Tyre size       | Type of tyre                | Manufacturer | Tread depth |
|----|-----------------|-----------------------------|--------------|-------------|
| 1) | 235/60 R18 107H | Winter tyres on Light alloy | Pirelli      | 2mm / 2mm   |
| 2) | 235/60 R18 107H | Winter tyres on Light alloy | Pirelli      | 2mm / 2mm   |

### Additional tyres

| #  | Tyre size       | Type of tyre                    | Manufacturer | Tread depth |
|----|-----------------|---------------------------------|--------------|-------------|
| 1) | 235/55 R19 105H | All-season tyres on Light alloy | Michelin     | 4mm / 4mm   |
| 2) | 235/55 R19 105H | All-season tyres on Light alloy | Michelin     | 4mm / 4mm   |

### Replacement

| Typ | Tyre size | Type of tyre            | Manufacturer | Tread depth |
|-----|-----------|-------------------------|--------------|-------------|
|     | Tirefit   | Expiration date 11/2026 |              |             |

**Legend:** Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



## Equipment



## Standard equipment

- ABS - Anti-lock Braking System
- Driver and passenger side airbags with two-stage deployment system
- Airbag, side airbags for driver and front passenger and head/shoulder airbags for all occupants
- Ambient lighting
- Electrically folding exterior mirrors
- Heated exterior mirrors and rear window (automatic)
- Hill Descent Control (HDC)
- Fog sensor for automatic activation of the defroster function
- On-board computer
- Chrome applications on the rear of the vehicle
- Chrome trim strip in the door sill area with Recharge lettering
- Aluminum roof rails (integrated)
- Digital services including Google Maps navigation system
- Rear parking assist with automatic braking intervention (rear)
- Electronic differential lock
- Electric windows front and rear
- Chrome window surround
- Luggage compartment partition net
- Front seat belt height adjustment
- Interior and exterior mirrors automatically dimming
- Intelligent driver information system
- Keyless Drive (electronic access system)
- Child safety lock for the rear doors (electric)
- Headrests (5) front and rear
- Charging box under the cargo floor
- Stainless steel loading sill protector in the luggage compartment
- Cargo area roller blind
- Steering wheel adjustable for height and reach
- Steering wheel: Three-spoke steering wheel, leather-free
- Illuminated makeup mirror for driver and front passenger
- Emergency brake lights
- Package: Parking Assistance Package (front and rear parking aid with automatic braking intervention (rear) - reversing camera)
- Package: Winter Package (front seat heating - rear seat heating - steering wheel heating)
- Panoramic glass sliding sunroof with lifting function (electric) (with integrated, continuously adjustable sunshade)
- Parking ticket holder
- Radio accessories: Two USB-C ports on the back of the center console
- Run-off Road Protection
- Wheels: Tire sealant
- Rear seats in a 40/60 split or completely foldable with pass-through function
- Speed-sensitive power steering
- Seats: Driver and front passenger seats are height-adjustable (electrically)
- Start/Stop technology
- Acoustic Vehicle Alerting System (AVAS)
- Passenger side airbag can be deactivated
- Airbag, driver's knee airbag
- Active safety belts with belt tensioners
- All-wheel drive (AWD)
- Android infotainment system
- Electrically adjustable exterior mirrors
- Outdoor temperature display
- Hill Start Assist (HSA)
- LED turn signals integrated into the exterior mirrors
- third brake light
- Chrome applications in the front bumper
- CleanZone air quality system with activated carbon filter
- Roof edge spoiler
- Deactivating the high-voltage battery
- Digital Instrumentation 2nd Gen.
- Aluminum door sill plates with Recharge lettering, front
- Electronic Stability Control (ESC)
- Enhanced air quality system with fine dust filtration according to air quality standard PM2.5
- Automatic emergency braking
- Transmission: 8-speed automatic transmission
- Automatic tailgate
- Interior lighting
- ISOFIX mounting for the outer rear seats
- Keyless Start
- Automatic climate control with separate temperature control for driver and front passenger
- Charging cable Schuko/Type 2 (Mode 2) (7 m length, 1-phase, 10A (for connection to a standard 230-volt household socket))
- LED headlights "Thor's Hammer" with high beam assist and integrated LED daytime running lights
- Steering wheel: Multifunction buttons on the steering wheel
- Front center armrest with integrated storage compartment and cup holders
- Package: Seat Comfort Package (Electrically adjustable front passenger seat - Electrically adjustable driver's seat with memory function for driver's seat and exterior mirror settings (stored in remote control) - Lumbar support (4-way electrically adjustable) for driver and front passenger seats - Memory function for front passenger seat - Adjustable leg support for driver and front passenger seats)
- Electric parking brake
- Upholstery: Leather/leatherette comfort seats, anthracite
- Rain sensor
- Tire pressure monitoring system
- Wheels: 19" alloy wheels, 5-V-spoke sport design, diamond cut/high-gloss black
- Safety Assistance
- Whiplash Protection System (WHIPS)



- Phone: Inductive smartphone charging system
- Glazing: Colored glazing
- Preparation for Trailer Stability Assist (TSA)
- Immobiliser
- Central locking system with two remote controls and integrated emergency keys

- Safety braking system with disc brakes all around (internally ventilated)
- Auxiliary heater including timer (fuel-operated)
- Power socket
- First aid kit and warning triangle
- Lashing eyes in the luggage compartment (foldable)
- Warning tone/indicator when seat belts are not fastened (for all seats)

### Extra equipment

- Towbar (semi-electric)
- Paint finish: Metallic paint
- Package: Light Package (Headlight cleaning system - Full LED headlights "Thor's Hammer" Active High Beam with extended high beam, dynamic cornering lights, intelligent high beam assistant with adaptive headlight range control and integrated LED daytime running lights)
- Radio: Premium Sound audio system by Harman Kardon (600 watts of power - 14 speakers - Fresh Air - Subwoofer - Dirac Unison - Sound optimization)
- Glazing: Side and rear windows tinted (from the B-pillar back)
- Surcharge Plus
- Package: Driver Assistance Package (Driver Assistance: - Adaptive Cruise Control - Emergency Stop Assist - Automatic emergency braking system if warnings are ignored - Pilot Assist - Lane Keeping Assist up to speeds of 130 km/h Driver Awareness: - Blind Spot Information System - Blind Spot Assist including Lane Change Warning for rapidly approaching vehicles including steering intervention - Cross Traffic Alert - Cross-traffic alert with braking intervention - Rear Impact Mitigation - Preventive protection in case of an impending rear-end collision)

### Brief expert findings

|                      |                                                                                                                                                                                                                                               |
|----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)                                                                  |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.                                                                     |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent. |
| Test drive           | No test drive/shunting maneuver was carried out during the inspection of the vehicle.                                                                                                                                                         |
| Engine function test | An engine test run was performed.                                                                                                                                                                                                             |
| readiness to drive   | The vehicle was roadworthy at the time of inspection.                                                                                                                                                                                         |

### Value reducing factors

| No. | Component group          | Description                                          |
|-----|--------------------------|------------------------------------------------------|
| 1   | Wing mirror - right side | Cap - Scratch(es) - Smart repair                     |
| 2   | Door - front left side   | Door edge - Scratch(es) - Smart repair               |
| 3   | Door - rear left side    | Door edge - Scratch(es) - Smart repair               |
| 4   | Seat - rear              | Back seat - Holes - Smart repair                     |
| 5   | Seat - front             | Seat cover - right side - Scratch(es) - Smart repair |
| 6   | Mudguard - left side     | Mudguard - left side - dent(s) - Smart repair        |
| 7   | Front bumper             | Front bumper - Scratch(es) - Paint                   |
| 8   | Body                     | Body - Damage by hail - Smart repair                 |



## Wear and tear

| No. | Component group | Description                                                                           |
|-----|-----------------|---------------------------------------------------------------------------------------|
| 1   | Wheel / tyres   | Tyres - complete set (WR) - Worn - No deduction                                       |
| 2   | 2nd wheel set   | 2nd wheel set (GJR statt SR) - Differs from the original configuration - No deduction |

The vehicle shows signs of wear and tear commensurate with its age and use.

## Repainting

| No. | Repainting                                                                                                                                    |
|-----|-----------------------------------------------------------------------------------------------------------------------------------------------|
| 1   | Mudguard - right side, Side panel - rear right side, Door - front right side, Professionally carried out, Invoice of repair done Non-existent |

## Paint coat thickness measurement

|                         |        |                              |        |
|-------------------------|--------|------------------------------|--------|
| Mudguard - right side   | 203 µm | Side panel - rear right side | 325 µm |
| Door - front right side | 201 µm |                              |        |

## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



## Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich - Mehrkosten möglich.
- Für den montierten Radsatz wurde kein Nachweis erbracht.
- Winterradsatz ist kein Bestandteil des Auslieferumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

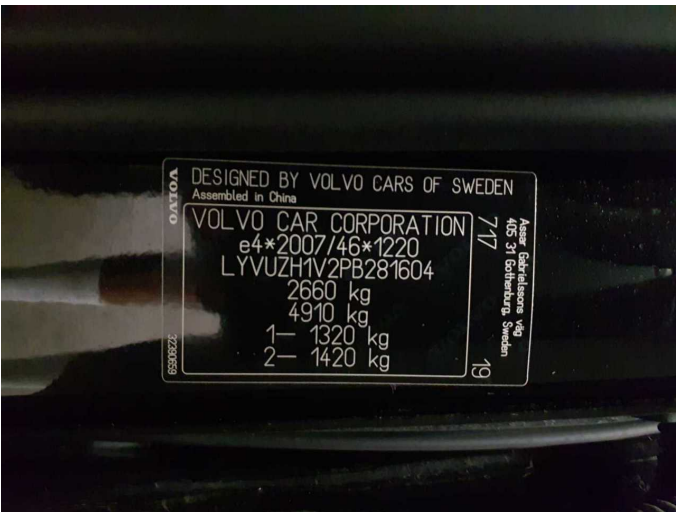


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

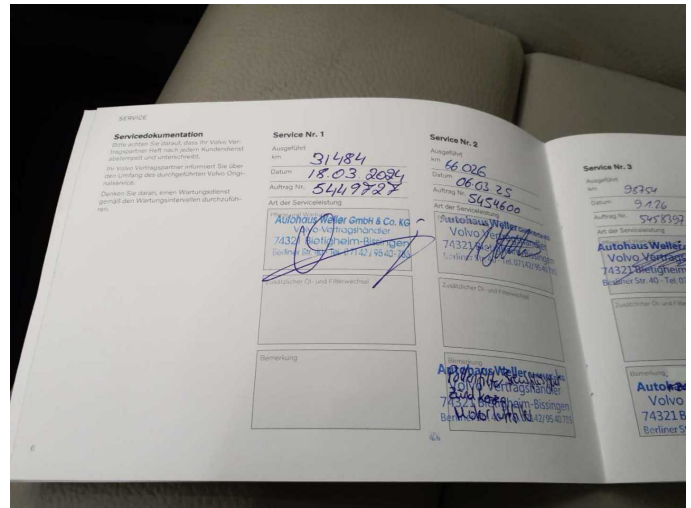


Figure 14: Documents

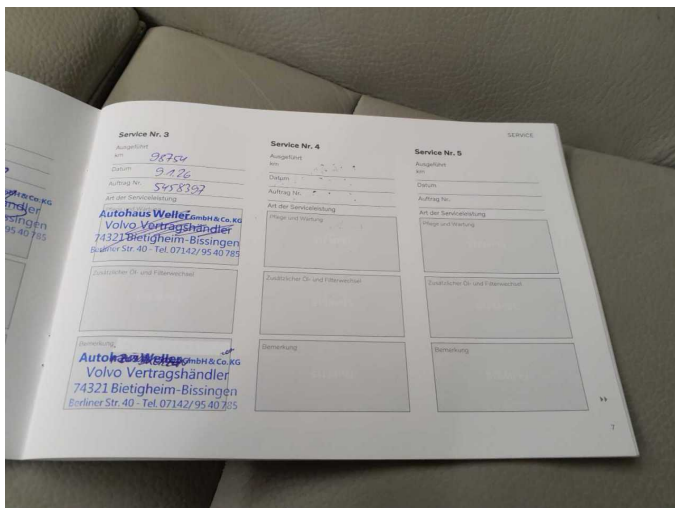


Figure 15: Documents



Figure 16: Documents

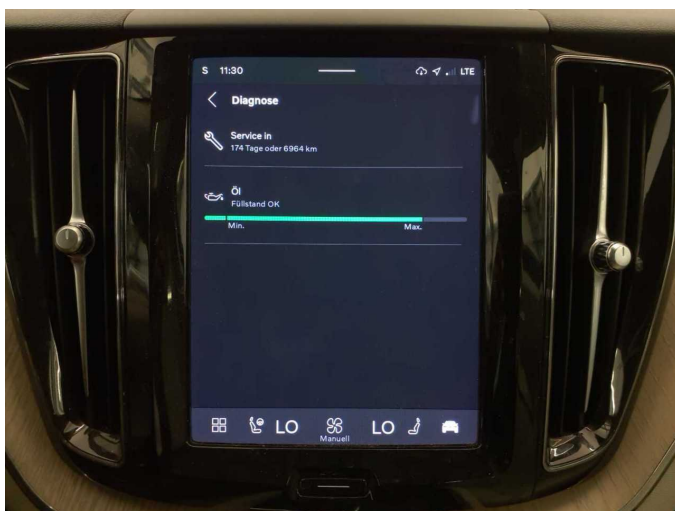


Figure 17: Documents



Figure 18: Additional tyres

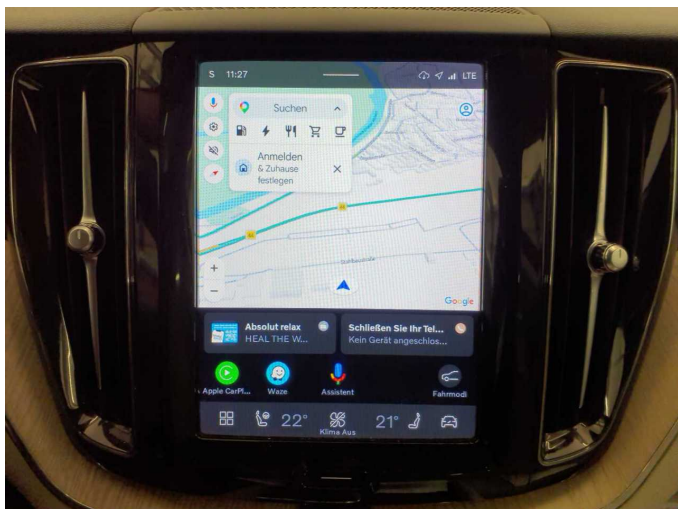


Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

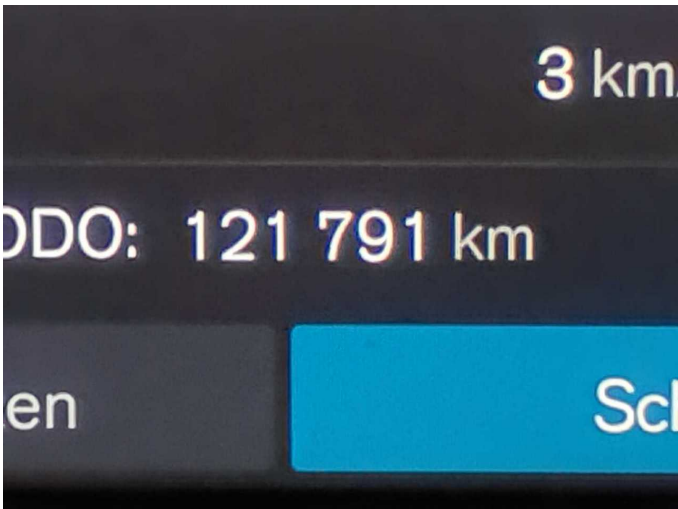


Figure 29: Misc.

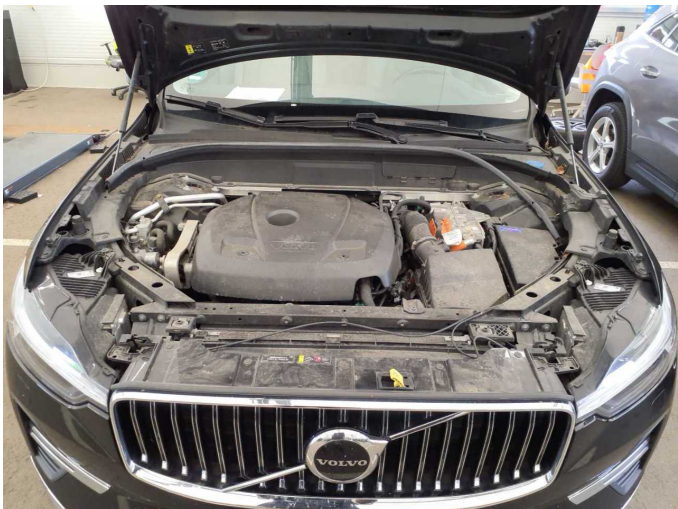


Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.

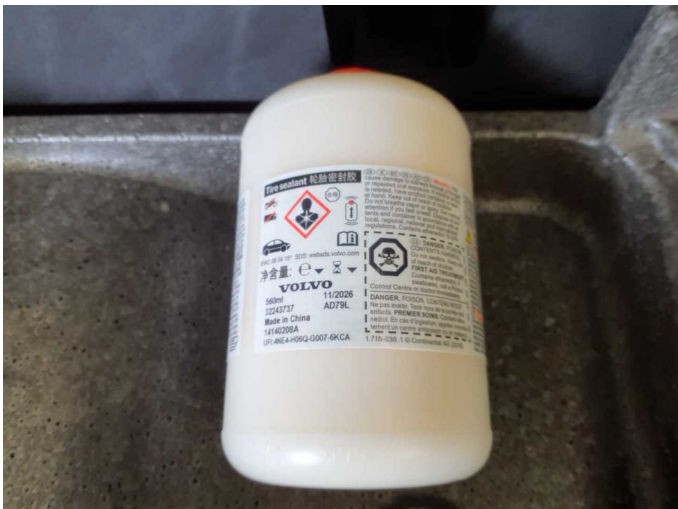
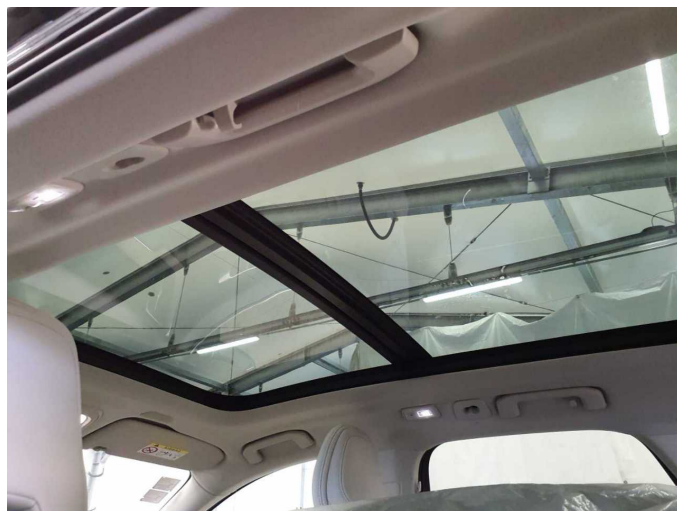


Figure 36: Misc.



**Figure 37:** Misc.



**Figure 38:** Misc.



**Damage 1:** Wing mirror - right side: Cap - Scratch(es) - Smart repair



**Damage 1:** Wing mirror - right side: Cap - Scratch(es) - Smart repair




**Damage 2:** Door - front left side: Door edge - Scratch(es) - Smart repair



**Damage 2:** Door - front left side: Door edge - Scratch(es) - Smart repair



**Damage 2:** Door - front left side: Door edge - Scratch(es) - Smart repair

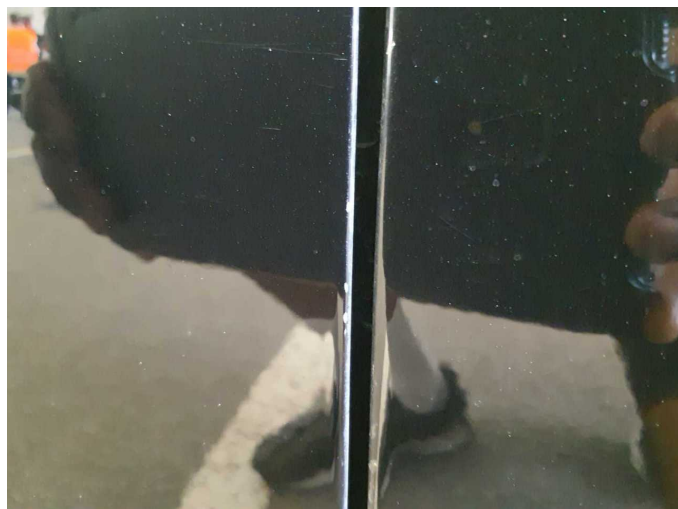


**Damage 2:** Door - front left side: Door edge - Scratch(es) - Smart repair



**Damage 3:** Door - rear left side: Door edge - Scratch(es) - Smart repair



**Damage 3:** Door - rear left side: Door edge - Scratch(es) - Smart repair

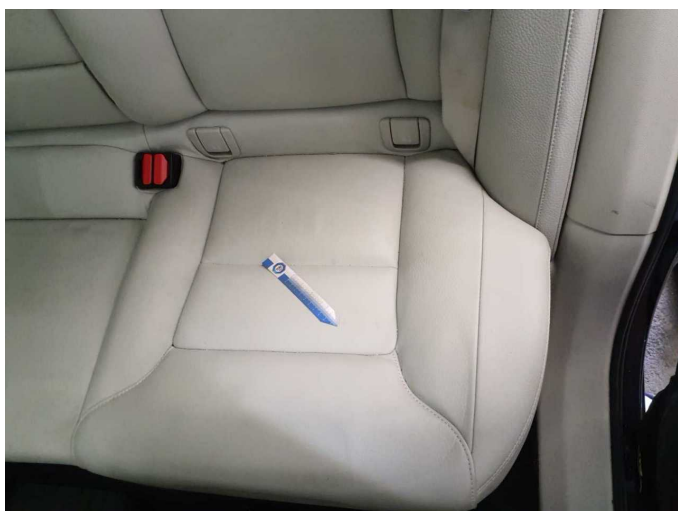

**Damage 4:** Seat - rear: Back seat - Holes - Smart repair



**Damage 4:** Seat - rear: Back seat - Holes - Smart repair




**Damage 5:** Seat - front: Seat cover - right side - Scratch(es) - Smart repair




**Damage 5:** Seat - front: Seat cover - right side - Scratch(es) - Smart repair




**Damage 6:** Mudguard - left side: Mudguard - left side - dent(s) - Smart repair

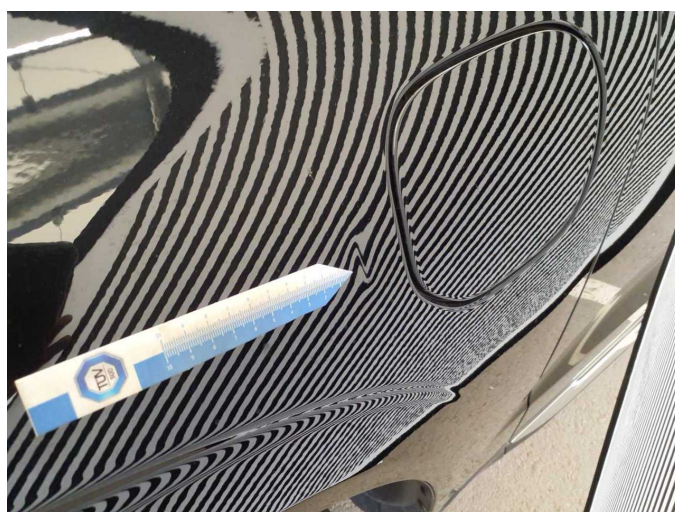


**Damage 6:** Mudguard - left side: Mudguard - left side - dent(s) - Smart repair

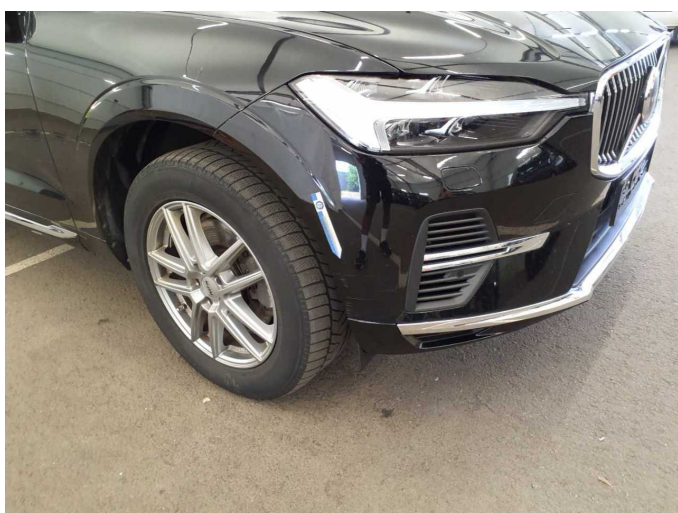


**Damage 7:** Front bumper: Front bumper - Scratch(es) - Paint

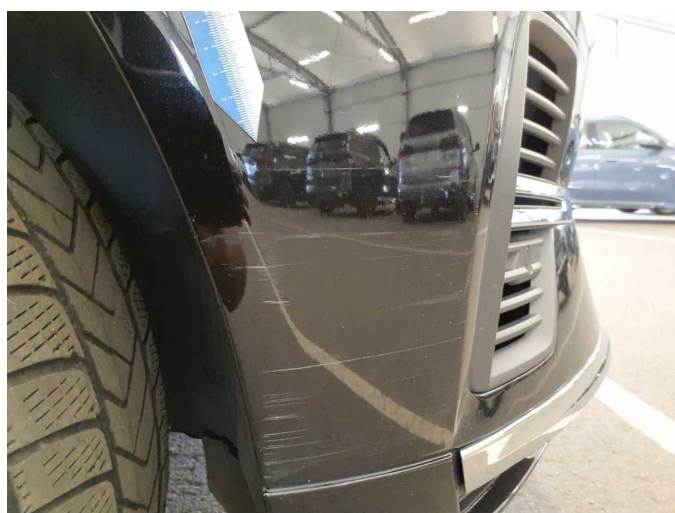


**Damage 7:** Front bumper: Front bumper - Scratch(es) - Paint

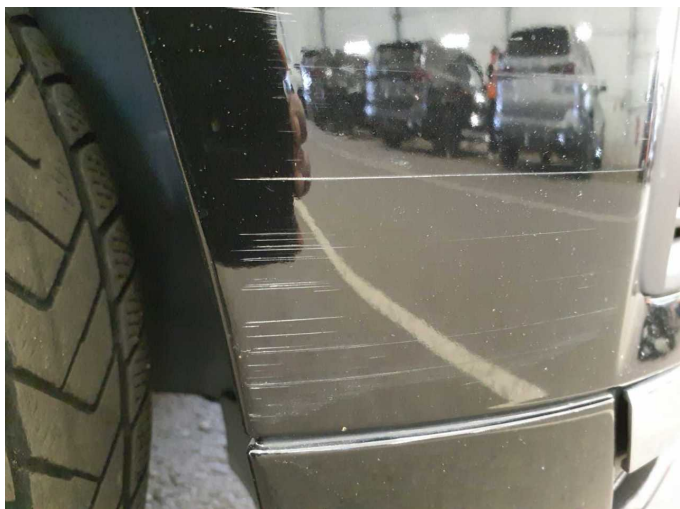

**Damage 7:** Front bumper: Front bumper - Scratch(es) - Paint

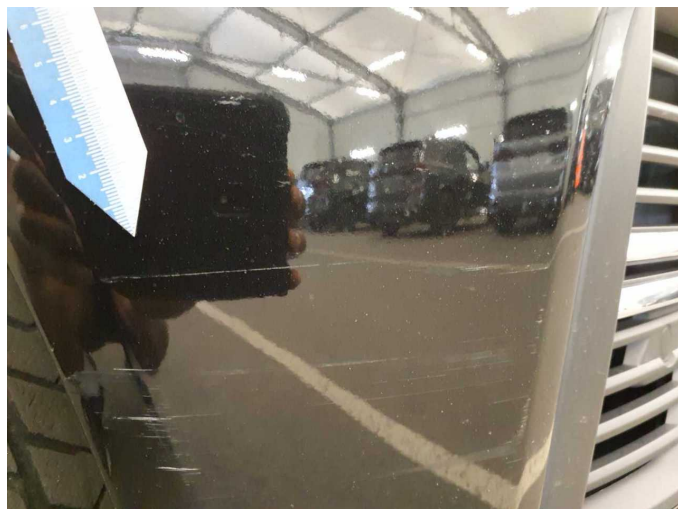

**Damage 7:** Front bumper: Front bumper - Scratch(es) - Paint

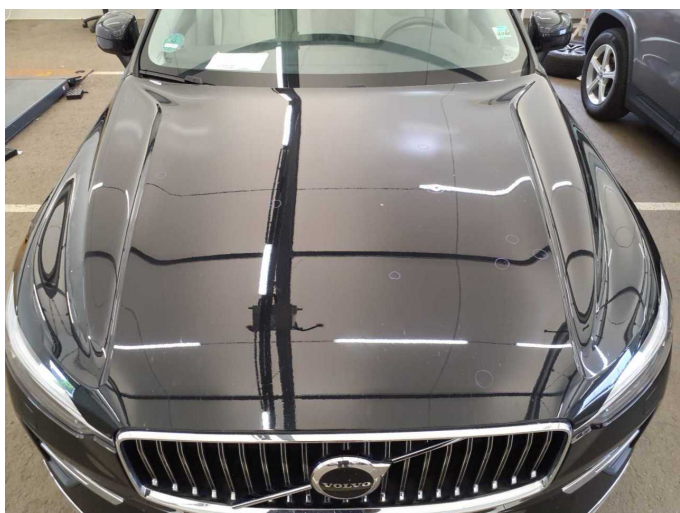


**Damage 8:** Body: Body - Damage by hail - Smart repair




**Damage 8:** Body: Body - Damage by hail - Smart repair



**Damage 8:** Body: Body - Damage by hail - Smart repair

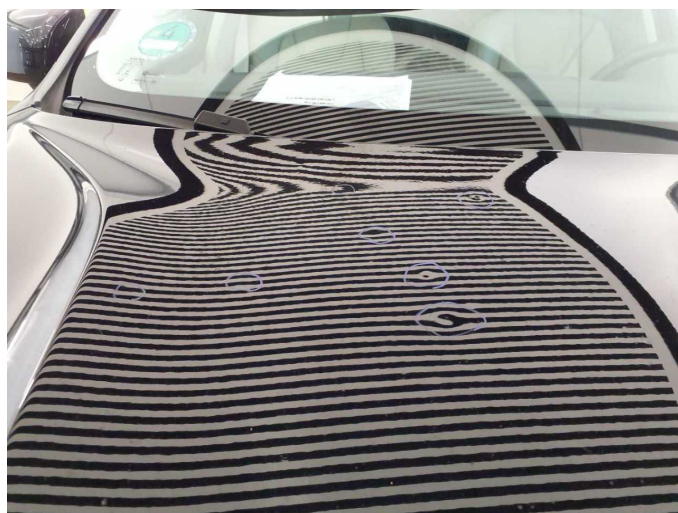

**Damage 8:** Body: Body - Damage by hail - Smart repair

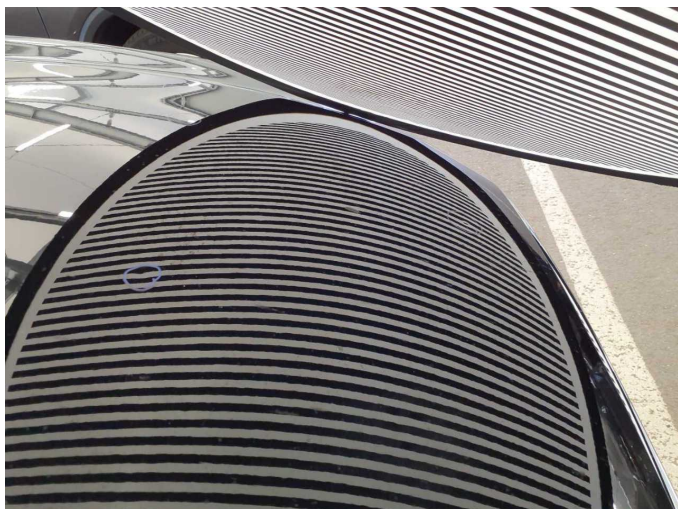

**Damage 8:** Body: Body - Damage by hail - Smart repair



**Damage 8:** Body: Body - Damage by hail - Smart repair




**Damage 8:** Body: Body - Damage by hail - Smart repair




**Damage 8:** Body: Body - Damage by hail - Smart repair



**Damage 8:** Body: Body - Damage by hail - Smart repair

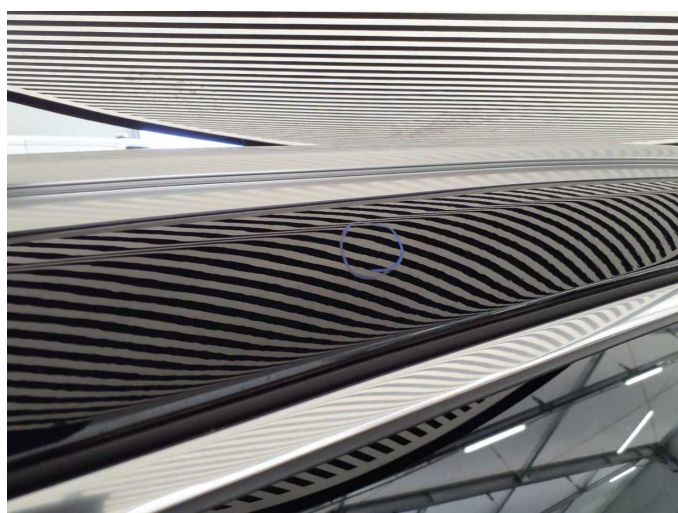

**Damage 8:** Body: Body - Damage by hail - Smart repair

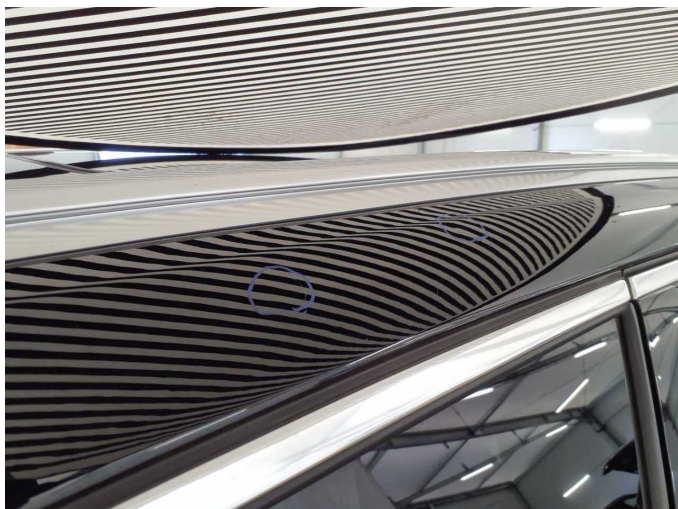


**Damage 8:** Body: Body - Damage by hail - Smart repair




**Damage 8:** Body: Body - Damage by hail - Smart repair



**Damage 8:** Body: Body - Damage by hail - Smart repair

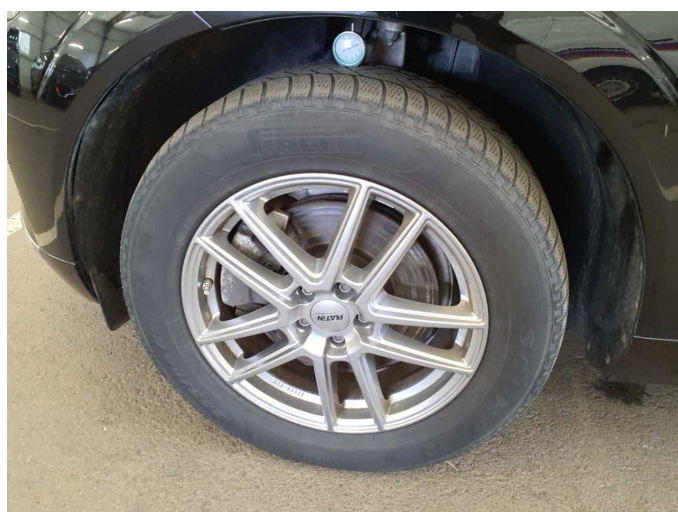

**Wear and tear 1:** Wheel / tyres: Tyres - complete set (WR) - Worn - No deduction

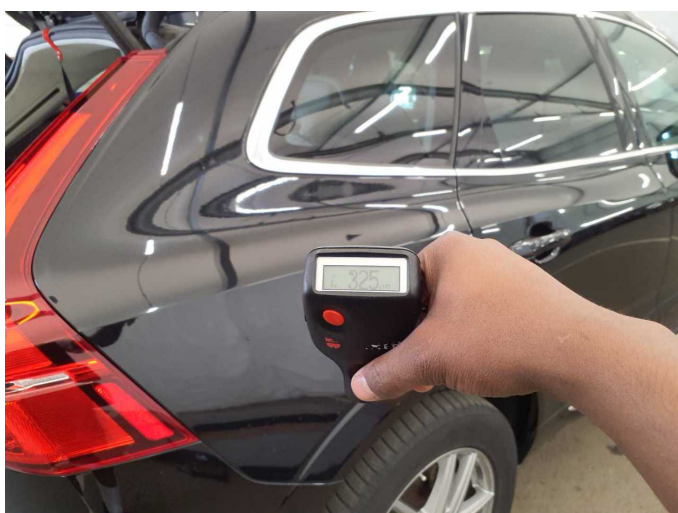

**Repainting 1:** Mudguard - right side, Side panel - rear right side, Door - front right side



**Repainting 1:** Mudguard - right side, Side panel - rear right side, Door - front right side



**Repainting 1:** Mudguard - right side, Side panel - rear right side, Door - front right side



**Repainting 1:** Mudguard - right side, Side panel - rear right side, Door - front right side



**Repainting 1:** Mudguard - right side, Side panel - rear right side, Door - front right side



**Repainting 1:** Mudguard - right side, Side panel - rear right side, Door - front right side



# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: LYVUZH1V2PB281604

Hersteller / Modell: VOLVO VOLVO XC60 T6 AWD Recharge Plus Bright

| Datum      | KM-Stand | Beschreibung                                                                                                                                                                 |
|------------|----------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 09.01.2026 | 98.754   | AU; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges                                                                            |
| 06.03.2025 | 66.026   | Bremsflüssigkeit; Bremsflüssigkeit ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges; Zündkerzen ern |
| 14.03.2024 | 31.484   | Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges                                                                                                     |