



Expertise

Protocol number: 46908407
Order No. / Reference: 26685897
Inspection date: 28 Jul 2026

Manufacturer: Ford	Model: Focus Turnier 1.5 EcoBlue Start-Stopp-System Aut. TITANIUM
VIN: WF0PXXGCHPMJ27709	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Focus Turnier 1.5 EcoBlue Start-Stopp-System Aut. TITANIUM	
Vehicle Identification number	WF0PXXGCHPMJ27709
Mileage (Read)	164,743 km
First registration	10 Mar 2021
Number of holders	2
Fuel type	Diesel
Engine displacement / Cylinder	1,499 ccm / 4
Power	88 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Frozen White
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite
Vehicle with smoke odor	Yes (ozone-treated)



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	71 %
Last service on / at	12/2024 at 126,878 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FZ480441
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BPV 00411		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,995 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Goodyear	6mm / 6mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Goodyear	4mm / 4mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92V	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	205/60 R16 92V	Summer tyres on Light alloy	Continental	4mm / 4mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag: Passenger airbag deactivation
- Anti-lock braking system (ABS) with electronic brake force distribution (EBD)
- Attachment points behind the second row of seats (for safety partition nets and safety partition grilles, e.g. for luggage compartment partition grilles behind the rear seats)
- Chrome trim (on side windows)
- Overhead console with glasses storage compartment
- Roof spoiler painted in car color
- Tachometer
- Electronic Stability Program (ESP) (with hill start assist, emergency brake assist (EBA) and traction control)
- Driving mode switch, selective
- Lane keeping assist including lane keeping assist
- Electric front and rear windows (with all-around closing function)
- Ford ECO-Coach (signals environmentally friendly driving style)
- FordPass Connect including eCall, live traffic information (only with navigation) and Wi-Fi hotspot (information about the current status or location of the vehicle as well as control of selected vehicle functions via smartphone with the FordPass app - eCall emergency call system to send an emergency call in the event of an accident or when manually activated - Real-time traffic information (only in conjunction with navigation system) - Wi-Fi hotspot (up to 4G/LTE7, for up to 10 mobile devices))
- Interior lighting with LED technology (front and rear and map reading lights at the front)
- Isofix mounting (including top tether anchor points on the outer seats of the 2nd row)
- Headrests: 2 front and 3 rear, height adjustable
- Charging station for mobile devices (inductive)
- LED taillights
- LED daytime running lights
- Steering column, adjustable (adjustable in height and reach)
- MyKey key system (individually programmable second key)
- Navigation: Ford Navigation, Ford SYNC 3 with AppLink, 8" touchscreen (20.3 cm) with DAB/DAB+ (Ford SYNC 3 communication and entertainment system with voice control, radio, 2 USB ports, 6 speakers and steering wheel remote control, Bluetooth hands-free calling and audio streaming, SMS reading and sending option, voice control for audio and telephone, support for Android Auto and Apple CarPlay, dynamic navigation with TMCpro, road map for Europe, voice control, destination input and search, advanced voice output, detailed visualization, Michelin travel guide for Europe)
- Front and rear parking pilot system
- Pollen filter and dust filter
- Upholstery: Cloth
- Pre-Collision Assist (Forward Alert system with pedestrian and bicycle detection)
- Tire repair kit (for use at a maximum speed of 80 km/h)
- Tire Pressure Monitoring System (TPMS)
- Ambient lighting in the front (including door storage, footwell and cup holder lighting with LED technology)
- Exterior mirrors in body color, driver and passenger side, electrically adjustable and heated (with integrated turn signals and ambient lighting and electrically foldable)
- Tires: 6.5 J x 16 alloy wheels (4) with 205/60 R 16 tires (in 15-spoke design)
- Fabric headliner
- Roof rails, aluminum
- Diesel particulate filter (DPF)
- Front door sill trim
- Driver information system (on-board computer with fuel consumption and mileage information as well as outside temperature display (monochrome in the Trend trim) - color)
- Electric parking brake with auto-hold function (with one-button operation)
- Ford Power Start function (with Ford Key Free system - keyless locking/unlocking)
- Luggage compartment lighting
- Luggage compartment floor, adjustable in two ways
- Speed limiter (Intelligent speed limiter with speed limit display)
- Cruise control
- Transmission: 8-speed automatic transmission
- Illuminated glove compartment
- Back window, heater
- rear window wiper
- Instrument lighting, adjustable
- Intelligent safety system (front airbag for driver and front passenger - front and rear head and shoulder airbags - side airbag for driver and front passenger - seat belt tensioners and force limiters in the front and on the outer seats of the 2nd row - 3-point seat belts on all seats, height-adjustable in the front - safety pedal assembly)
- Steering wheel: Leather steering wheel, 3-spoke design
- Rear center armrest (with 2 cup holders)
- Center console "Premium" front (armrest - 2 cup holders - storage compartments - 12-volt and USB connection)
- Fog lights (including static cornering lights)
- Emergency brake light (pulsating illumination of the brake lights during hard braking)
- Package: Comfort (2-zone automatic climate control for driver and front passenger side, separately adjustable - Ford Key Free system (keyless locking/unlocking) including Ford Power Start function (keyless starting) - Windscreen wipers with rain sensor, variable sensitivity adjustment - Interior mirror, automatically dimming - Headlights with delayed shut-off)
- Visibility package (windscreen wipers with rain sensor, adjustable sensitivity - interior mirror, automatically dimming - headlights with delayed shut-off)



- Reversing camera with "Split View" technology (with image transmission of the road behind in the TFT color display - thanks to the "Split View" technology, the field of vision in the new Ford Focus is further expanded and allows you to see what is coming towards you from both sides of the vehicle behind)
- Seats: Passenger seat height-adjustable, manually (with adjustable lumbar support)
- Seats: Rear seat backrest (foldable, 60:40 split)
- Start-stop system
- Carpet floor mats front and rear, velour
- Warning system for unfastened seat belts for the 1st and 2nd rows of seats
- Central/double locking (incl. remote control, remote luggage compartment and fuel filler flap release, door lock only on driver's side)

- Post-Collision Assist (In the event of a severe collision, which would also deploy the airbag and in which the driver might be incapacitated, this system initiates the braking process. This reduces the risk of colliding with further obstacles and road users after the initial collision. The driver can intervene and operate the accelerator or brake pedal manually throughout the entire process.)
- Headlight dipped beam (with switch-off delay)
- Headlight assistant with day/night sensor
- Electro-mechanical power steering (EPAS - Electric Power Assisted Steering)
- Seats: Driver's seat height adjustable (with manually adjustable lumbar support)
- Seats: Front sports seats with enhanced lateral support
- 12-volt power outlet in the luggage compartment
- Lashing eyes in the luggage compartment
- Electronic immobilizer
- Heat-insulating glazing, tinted
- Additional heating

Extra equipment

- Paint finish: Frost White
- Package: Winter (heated windscreen - heated steering wheel - individually and variably heated front seats)
- Safety partition net to separate passenger and luggage compartments
- Complete winter wheel set 205/60R16H

- Package: Easy Parking Package Plus (Active Parking Assist with parking and exit function and semi-automated vehicle guidance - Blind Spot Assist and Cross Traffic Alert with emergency braking function (when reversing out of a parking space) - Door edge protection)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Bonnet	Radiator grille - Scratched - Loss in value
2	Wheel / tyres	Alloy rim - front left side - Scratched - Loss in value
3	Wheel / tyres	Tyre - right - Does not meet the leasing specifications - Replace
4	Front bumper	Front bumper - Scratched - Paint
5	Rear bumper	Rear bumper - Broken / torn - Replace



Wear and tear

No.	Component group	Description
1	Trim / covers	Carpet - front left side - Holes - No deduction
2	2nd wheel set	1 alloy rim - Scratched - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Side panel - rear right side	Elbow - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Tirefit filler

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Roof, Front, Rear, Provided by user / customer, from 29 Dec 2022	7.715,62 €

Repainting

No. Repainting

1 Roof, Roof rail - left side, Roof rail - right side, Boot lid / rear door, Bonnet, Side panel - rear left side, Professionally carried out

Paint coat thickness measurement

Roof	164 µm	Roof rail - left side	433 µm
Roof rail - right side	222 µm	Boot lid / rear door	183 µm
Bonnet	187 µm	Side panel - rear left side	209 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Das Fahrzeug befand sich zum Besichtigungszeitpunkt in beschädigtem, nicht demontiertem Zustand. Schadenausweitung möglich, Zusatzkosten können entstehen.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view

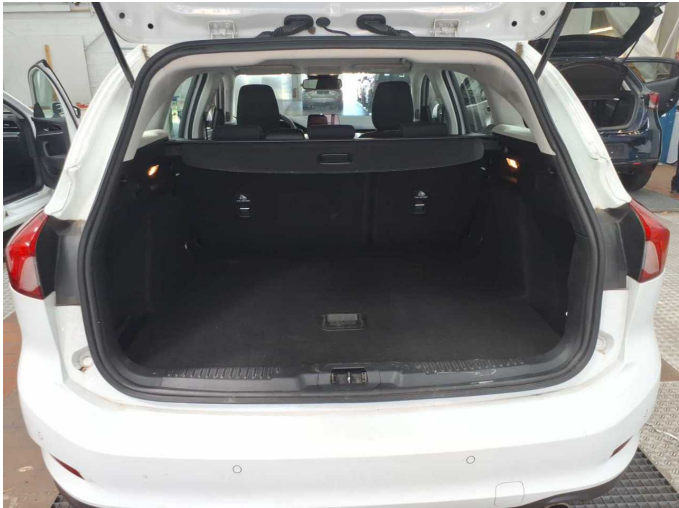


Figure 10: Cargo area

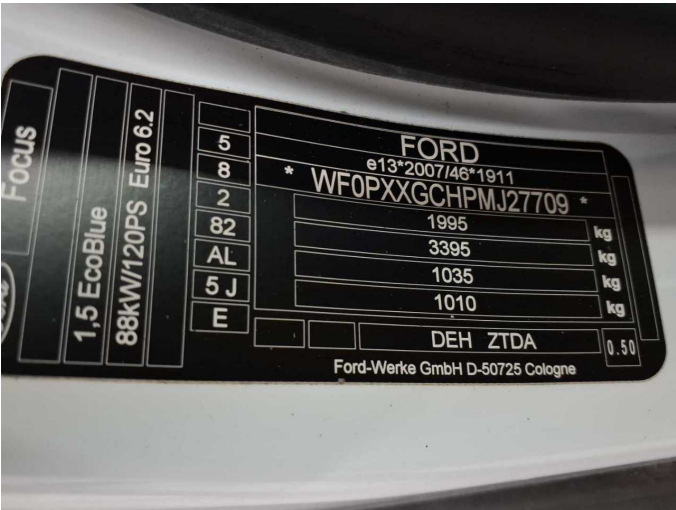


Figure 11: VIN



Figure 12: Mounted tyres

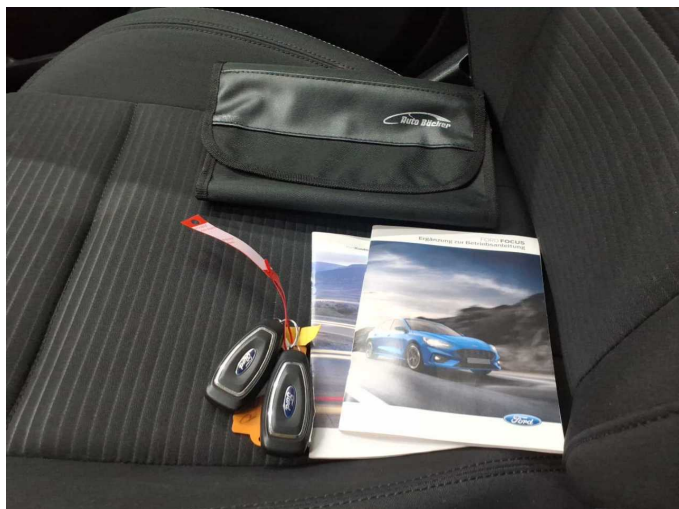


Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres

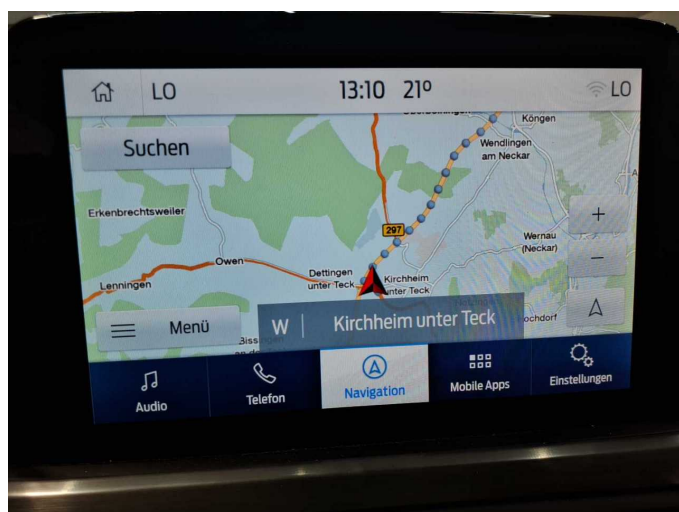


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.

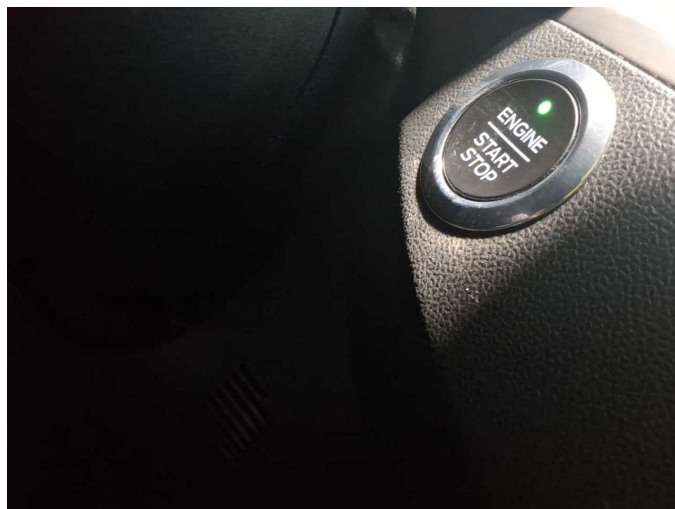


Figure 20: Misc.



Figure 21: Misc.

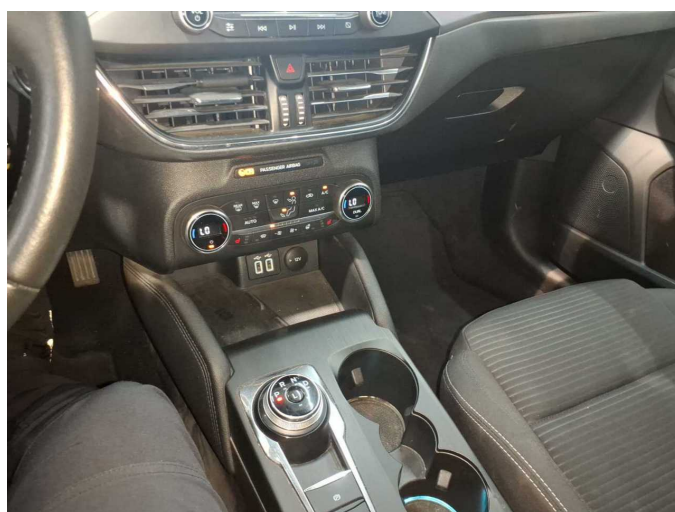


Figure 22: Misc.



Figure 23: Misc.

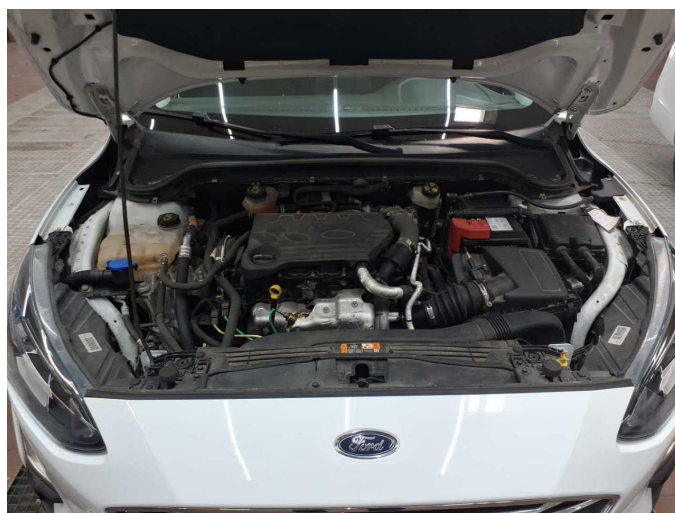


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.




Damage 1: Bonnet: Radiator grille - Scratched - Loss in value



Damage 1: Bonnet: Radiator grille - Scratched - Loss in value




Damage 2: Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value

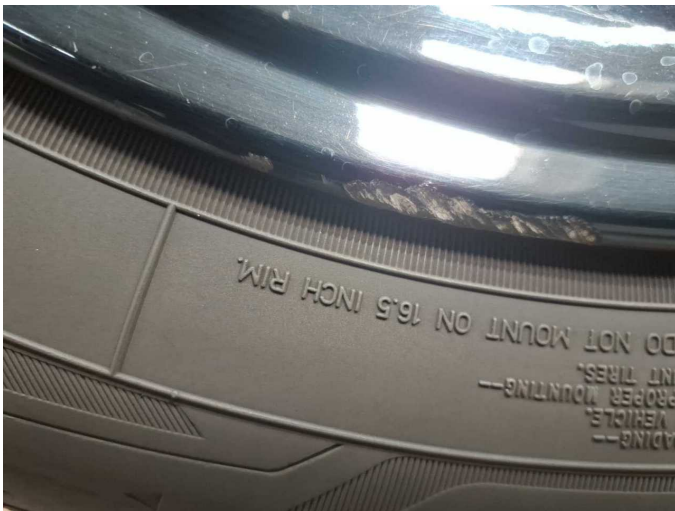


Damage 2: Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value



Damage 3: Wheel / tyres: Tyre - right - Does not meet the leasing specifications - Replace

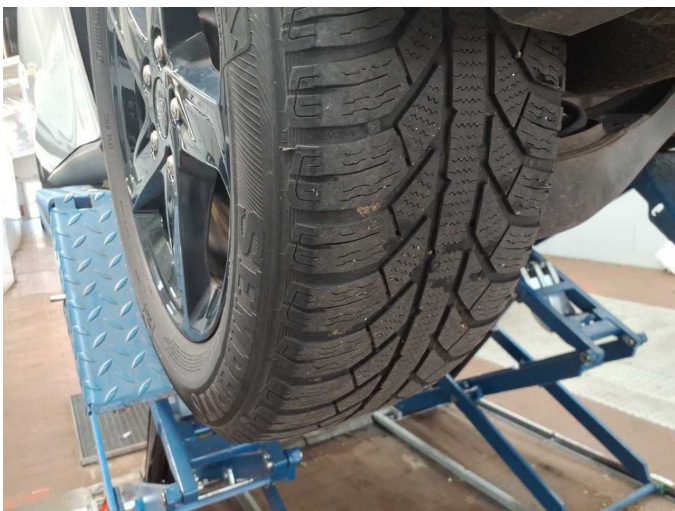

Damage 3: Wheel / tyres: Tyre - right - Does not meet the leasing specifications - Replace

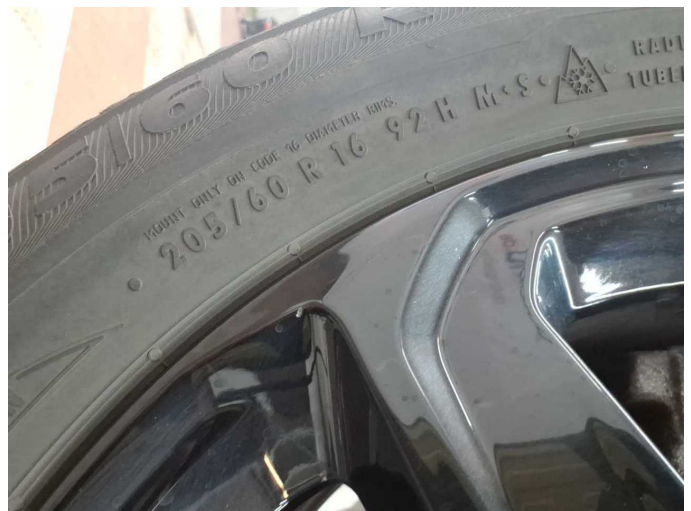

Damage 3: Wheel / tyres: Tyre - right - Does not meet the leasing specifications - Replace



Damage 3: Wheel / tyres: Tyre - right - Does not meet the leasing specifications - Replace



Damage 3: Wheel / tyres: Tyre - right - Does not meet the leasing specifications - Replace



Damage 4: Front bumper: Front bumper - Scratched - Paint



Damage 4: Front bumper: Front bumper - Scratched - Paint



Damage 4: Front bumper: Front bumper - Scratched - Paint



Damage 4: Front bumper: Front bumper - Scratched - Paint




Damage 4: Front bumper: Front bumper - Scratched - Paint



Damage 4: Front bumper: Front bumper - Scratched - Paint



Damage 4: Front bumper: Front bumper - Scratched - Paint

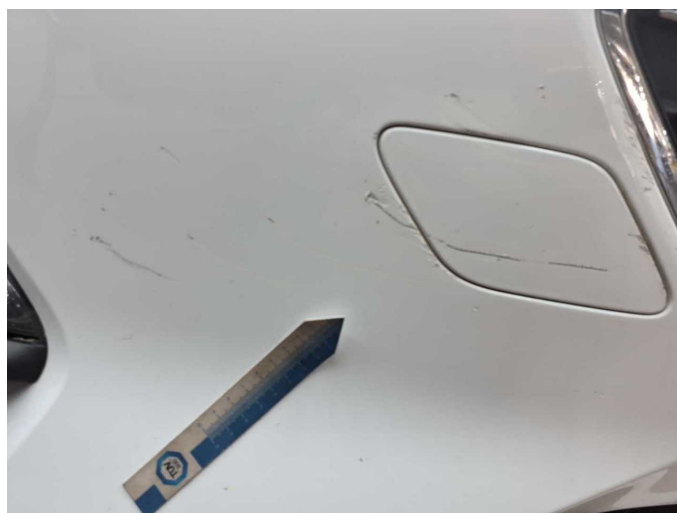


Damage 4: Front bumper: Front bumper - Scratched - Paint




Damage 5: Rear bumper: Rear bumper - Broken / torn - Replace



Damage 5: Rear bumper: Rear bumper - Broken / torn - Replace

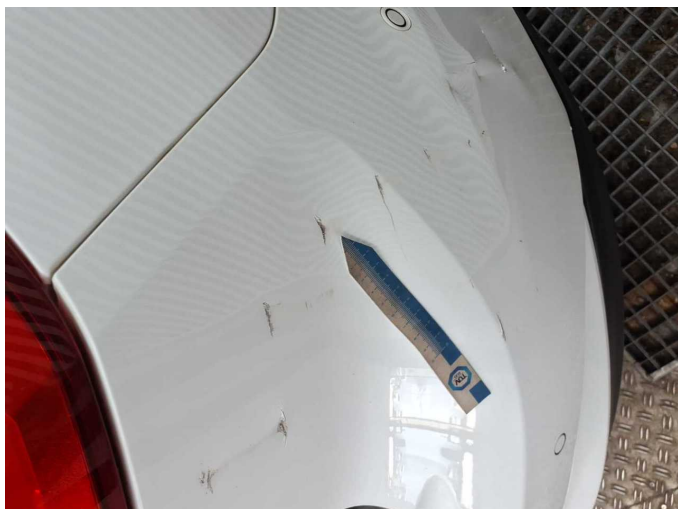

Damage 5: Rear bumper: Rear bumper - Broken / torn - Replace

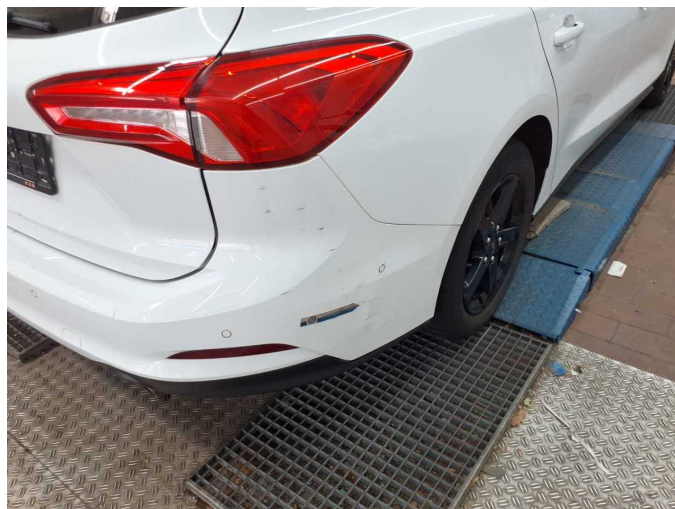

Damage 5: Rear bumper: Rear bumper - Broken / torn - Replace



Damage 5: Rear bumper: Rear bumper - Broken / torn - Replace



Damage 5: Rear bumper: Rear bumper - Broken / torn - Replace



Damage 5: Rear bumper: Rear bumper - Broken / torn - Replace



Damage 5: Rear bumper: Rear bumper - Broken / torn - Replace



Wear and tear 2: 2nd wheel set: 1 alloy rim - Scratched - No deduction



Wear and tear 2: 2nd wheel set: 1 alloy rim - Scratched - No deduction



Wear and tear 4: Side panel - rear right side: Elbow - dent(s) - No deduction



Wear and tear 4: Side panel - rear right side: Elbow - dent(s) - No deduction



Wear and tear 4: Side panel - rear right side: Elbow - dent(s) - No deduction



Wear and tear 4: Side panel - rear right side: Elbow - dent(s) - No deduction



Repainting 1: Roof, Roof rail - left side, Roof rail - right side, Boot lid / rear door, Bonnet, Side panel - rear left side



Repainting 1: Roof, Roof rail - left side, Roof rail - right side, Boot lid / rear door, Bonnet, Side panel - rear left side



Repainting 1: Roof, Roof rail - left side, Roof rail - right side, Boot lid / rear door, Bonnet, Side panel - rear left side



Repainting 1: Roof, Roof rail - left side, Roof rail - right side, Boot lid / rear door, Bonnet, Side panel - rear left side



Repainting 1: Roof, Roof rail - left side, Roof rail - right side, Boot lid / rear door, Bonnet, Side panel - rear left side



Repainting 1: Roof, Roof rail - left side, Roof rail - right side, Boot lid / rear door, Bonnet, Side panel - rear left side



Repainting 1: Roof, Roof rail - left side, Roof rail - right side, Boot lid / rear door, Bonnet, Side panel - rear left side



Repainting 1: Roof, Roof rail - left side, Roof rail - right side, Boot lid / rear door, Bonnet, Side panel - rear left side



Repainting 1: Roof, Roof rail - left side, Roof rail - right side, Boot lid / rear door, Bonnet, Side panel - rear left side



Repainting 1: Roof, Roof rail - left side, Roof rail - right side, Boot lid / rear door, Bonnet, Side panel - rear left side



Repainting 1: Roof, Roof rail - left side, Roof rail - right side, Boot lid / rear door, Bonnet, Side panel - rear left side



Repainting 1: Roof, Roof rail - left side, Roof rail - right side, Boot lid / rear door, Bonnet, Side panel - rear left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0PXXGCHPMJ27709

Hersteller / Modell: FORD FORD Focus Turnier 1.5 EcoBlue Start-Stopp-System Aut.
TITANIUM

Datum	KM-Stand	Beschreibung
16.12.2024	126.878	HU + AU; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
13.11.2024	128.846	Dieselpartikelfilter ern; Systemtest/Eigendiagnose
10.10.2023	99.208	Batterie ern; Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/ Eigendiagnose; Wartung Sonstiges
19.07.2022	63.571	Bremse Sonstiges; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
15.09.2021	30.812	Kleine Inspektion; Motoröl b. Wartung; Ölfilter ern; Wartung Sonstiges