



Expertise

Protocol number: 46285834
Order No. / Reference: 26381529
Inspection date: 30 Jun 2026

Manufacturer: Peugeot

Model: 5008 BlueHDi 180 EAT8 GT Pack

VIN: VF3MJEHZUNS183710



Vehicle details	
Manufacturer / Type / Model / Equipment	
Peugeot 5008 BlueHDi 180 EAT8 GT Pack	
Vehicle Identification number	VF3MJEHZUNS183710
Mileage (Read)	165,258 km
First registration	22 May 2023
Number of holders	2
Next periodical technical inspection	04/2028
(Report on hand)	
Power / Engine displacement	130 kw / 1,997 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Platinum Grau Metallic
Doors / Seats	5 / 7
Upholstery type	Leather
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	7 Monat(e)
Last service on / at	01/2026 at 152,524 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GG055052
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	3003 / AZF 00092		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,280 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99V	Winter tyres on Light alloy	Kleber	5mm / 5mm
2)	215/65 R17 99H	Winter tyres on Light alloy	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R19 97V	Summer tyres on Light alloy	Michelin	4mm / 4mm
2)	205/55 R19 97V	Summer tyres on Light alloy	Michelin	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- ABS (Anti-lock Braking System)
- Airbag: Front and rear side airbags
- Airbag: Curtain airbags front and rear
- Adaptive Cruise Control (ACC) with Stop & Go function including lane positioning assistant (and Active Safety Brake Plus (for night driving and cyclists))
- Exterior mirrors in Perla Nera Black
- Hill start assist
- Chrome trim strips on the lower part of the doors
- Chrome trim strips above the side windows
- Chrome trim strips below the side windows
- Black Diamond roof (roof in Perla Nera black) (exterior mirror caps in Perla Nera black - rear spoiler in glossy black)
- Alcantara "Grevat" decorative inserts for door panels and dashboard
- Digital instrument cluster with high-resolution 12.3" screen, adjustable and customizable
- Rear parking aid, acoustic and visual
- ESP (Electronic Stability Program) with ASR (Anti-Slip Regulation)
- Misfueling protection
- Electric front and rear windows (with comfort operation and anti-pinch protection)
- High beam assist
- Follow-me-home function (automatic)
- Front bumper in chrome look
- Floor mats (front and rear)
- Cruise control system with speed limiter
- Cup holder in the center console
- tailgate sensor-controlled
- Heated rear window
- rear window wiper
- Interior mirror automatically dimming
- Frameless interior mirror
- Keyless system (keyless access and start system)
- Child safety locks on the rear doors
- Automatic climate control (2-zone), with activated carbon filter (separately adjustable for driver and front passenger)
- Rear headrests (3) (height adjustable and lowerable)
- White LED ambient lighting in the front footwell
- LED taillights with 3D effect
- Steering wheel: Multifunction leather steering wheel
- Steering wheel: small multifunction steering wheel, flattened at the top and bottom
- Front center armrest, two-piece, with storage compartment, illuminated and climate-controlled
- Fog light
- Emergency brake assist (with automatic activation of the hazard warning lights)
- Package: Easy Package (Reversing camera with 360° surround view - Park Assist: Active parking system with automatic steering for parallel and perpendicular parking spaces)
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Active Blind Spot Assist
- Electrically folding exterior mirrors with LED approach lighting
- Electrically adjustable and heated exterior mirrors with integrated LED turn signals
- On-board computer (outside temperature and maintenance display - average and current fuel consumption - remaining range - distance traveled - average speed)
- Black headliner
- Aluminum roof rails
- Ceiling light - LED at the front, in row 2 and in row 3, 2 LED reading lights at the front, in row 2 and in row 3
- Decorative trim on the dashboard and door panels in satin chrome
- EBV (Electronic Brakeforce Distribution)
- Front parking aid, acoustic and visual
- Driving mode switch (Sport - Normal - Eco) (Sport mode to activate the following functions: - Display of driving dynamics parameters on the instrument cluster - More responsive accelerator pedal response - More responsive power steering - Increased engine noise)
- electric parking brake
- Front collision warning
- Full LED headlights with automatic headlight range control (with static cornering lights and (Foggy Mode) function)
- Transmission: 8-speed automatic transmission EAT8
- Seat belts: 3-point seat belts (Front seats: - Height-adjustable three-point seat belts with belt locks - Pyrotechnic belt tensioners and electronically controlled belt force limiters - Warning light and warning signal when the seat belt is not fastened or is released for driver and front passenger Rear seats: - 3 three-point seat belts - 3 three-point Isofix child seat anchors in the 2nd row - Belt force limiters on the side seats - Warning light and warning signal when the seat belt is released)
- Front headrests (2) (Safety optimized)
- Chrome-plated loading sill protector
- Blue LED lighting on the door panel
- LED daytime running lights and LED turn signals at the front
- light sensor
- Makeup mirror (illuminated for driver and front passenger)
- Fatigue warning
- Navigation system: 3D navigation system NAC (3D navigation including 3D display of buildings and monuments - voice recognition for navigation, telephone and media - real-time navigation by TomTom Services - map transfer to the digital instrument cluster - multifunctional touchscreen with 10" color capacitive screen, piano key toggle switches)
- Package: Children's Package (Allure Pack, GT, GT Pack) (Folding tables on the front seatbacks - Map pockets on the front seatbacks - Sunshades in row 2)



- Particulate filter: FAP diesel particulate filter
- Aluminum pedals and stainless steel door sills
- Peugeot Connect Box (with the free telematics services Peugeot Connect SOS and Peugeot Connect Assistance - GPS module - Integrated European SIM card - Speaker and microphone - Emergency battery)
- Radio: FOCAL sound system (total output 515 watts - 10 speakers including center speaker and subwoofer - HiFi woofer and midrange speaker as well as TNF tweeter - 12-channel amplifier - speaker grilles of the center speaker and tweeter in Belem Bronze color)
- Radio accessories: Digital radio reception DAB+
- Rain sensor
- Tire pressure monitoring system
- Wheels: 19" "San Francisco" alloy wheels, two-tone (with 205/55 R 19 tires)
- Wheels: Tire repair kit (compressor + tire sealant spray)
- paddle shifters on the steering wheel
- Side windows in the second row and rear window are more heavily tinted.
- Seats: 3 separate individual seats in row 2 (foldable, with longitudinal adjustment and backrest tilt adjustment)
- Seats: Passenger seat foldable
- Seats: Heated front seats
- 12 Volt power outlet (3) (in the trunk, rows 1 and 2)
- Stop&Start system (automatic)
- Tie-down points in the trunk (4 pieces)
- Immobiliser

Extra equipment

- Detachable towbar (with removable ball head without tools)
- Night Vision (night vision system with display of the road situation at night in the instrument cluster)
- Package: Full Leather Package (Black) with AGR seal of approval (Black Nappa leather with grey and copper decorative stitching - Ergonomic comfort seats - Electrically adjustable driver's seat with memory function - Heated front seats - Extendable thigh support on driver and front passenger side - Electrically adjustable lumbar support on driver and front passenger side - Electrically adjustable seat cushion tilt on the front passenger side - Massage function for driver and front passenger seats - Genuine wood trim for door panels and dashboard.)
- Pre-installation for WEBASTO auxiliary heater

- Upholstery: Faux leather / Alcantara black with red decorative stitching
- Radio: RCC audio system (Bi-tuner - 6 speakers - MP3-compatible - Bluetooth hands-free system with audio streaming via Bluetooth - USB port - operation via steering wheel and touchscreen)
- Radio: Mirror Screen (Mirror Screen (Transfer of multimedia content and apps from a smartphone to the touchscreen in the vehicle, via which the compatible functions and apps can be operated directly - Mirror Link: Mirroring of the smartphone screen on the touchscreen (for compatible smartphone models with Android operating system) - CarPlay (for compatible iPhone models from Apple) - Android Auto and Mirror Link (for compatible smartphone models with Android operating system))
- Keyless start system
- Electric power steering
- Seats: 2 additional seats for the 3rd row (removable and fully retractable)
- Seats: Passenger seat height adjustable
- Seats: Driver's seat height adjustable
- Lane keeping assist with steering intervention
- Power outlet: Dual USB port (Type A) in row 2
- Traffic sign recognition (with display of the speed recommendation in the instrument cluster)
- Central locking system, activatable from inside via remote control (doors lock automatically when driving off)

- luggage compartment partition net
- Paint finish: Special metallic paint
- Package: Black Tone (5008 and GT logo and "PEUGEOT" lettering in satin black - roof rails in satin black - front bumper in gloss black - radiator grille in dark chrome - loading sill protector in Perla Nera black - 19" two-tone Washington alloy wheels in black - lion emblem front and rear in dark chrome - trim inserts on the front fenders in gloss black - trim strips on the lower part of the doors in black - side window trim in black - spare wheel well (not for Blue HDi 180 EAT8))
- Panoramic tilt/slide sunroof with electric blind (blue LED lighting - exterior mirrors with projection of the PEUGEOT lion onto the ground)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Electrical system	Power socket (hinten) - Incomplete - Replace
2	Rear bumper	Rear bumper (unpainted) - Scratched - Loss in value
3	Door - front right side	Door edge - Scratch(es) - Smart repair
4	Door - front left side	Door edge - Scratch(es) - Smart repair
5	Side panel - rear left side	Sill - Dent / paintcoat damage - Smart repair
6	Door - rear left side	Door - Dent / paintcoat damage - Smart repair
7	Side panel - rear right side	Sill - Dent / paintcoat damage - Smart repair
8	Interior	Interior - Scratched - Loss in value
9	Front bumper	Front strip - Broken / torn - Replace

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Trim / covers	Door trim - rear right side - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 7 Sept 2023	3.893,74 €

Paint coat thickness measurement

Door - rear left side	116 µm
-----------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Der Winterradsatz ist kein Bestandteil der Ausstattungsliste.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view

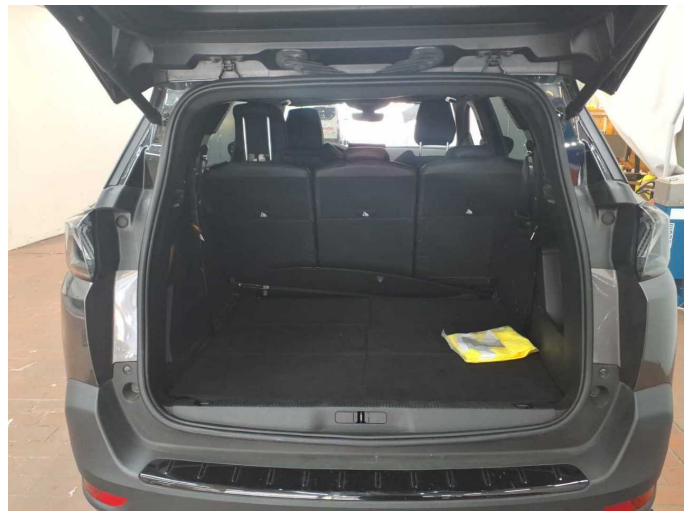


Figure 10: Cargo area

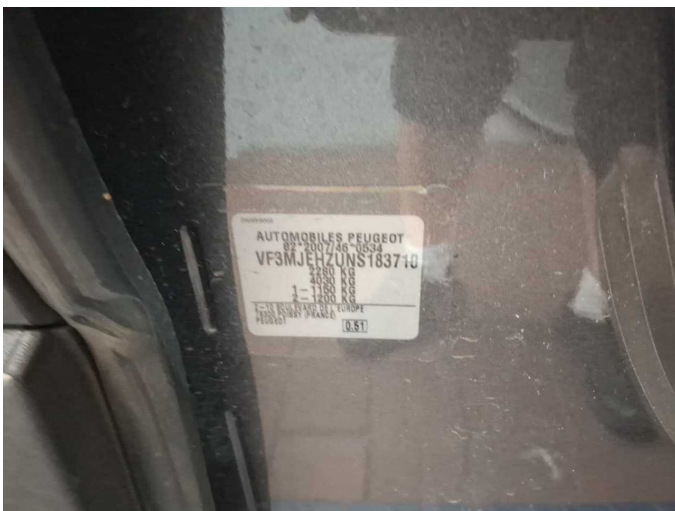


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

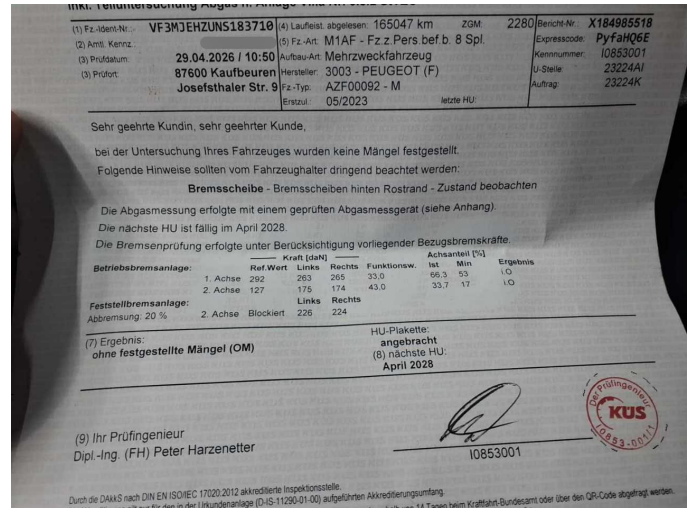


Figure 14: Documents

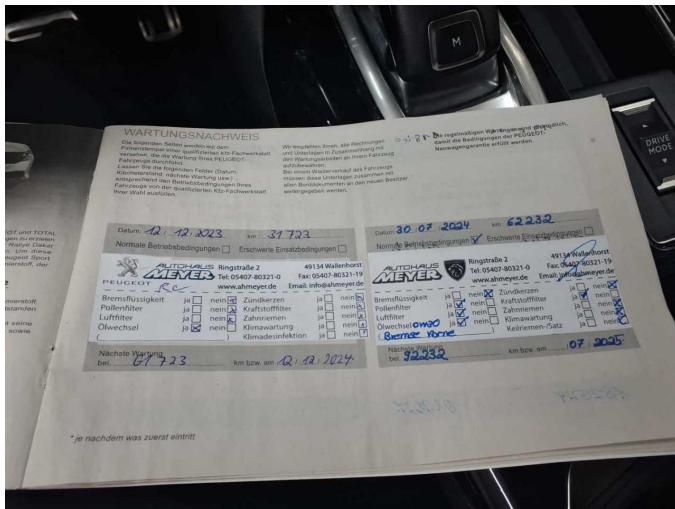


Figure 15: Documents



Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Additional tyres



Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.

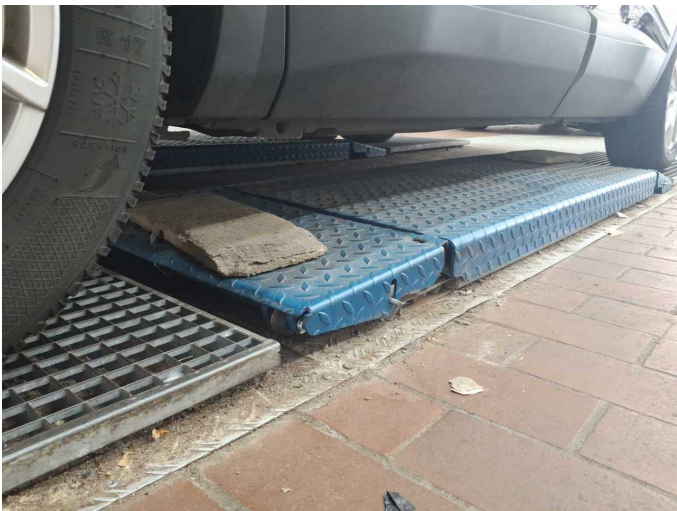


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Damage 1: Electrical system: Power socket (hinten) - Incomplete - Replace



Damage 2: Rear bumper: Rear bumper (unpainted) - Scratched - Loss in value



Damage 2: Rear bumper: Rear bumper (unpainted) - Scratched - Loss in value



Damage 2: Rear bumper: Rear bumper (unpainted) - Scratched - Loss in value



Damage 2: Rear bumper: Rear bumper (unpainted) - Scratched - Loss in value



Damage 3: Door - front right side: Door edge - Scratch(es) - Smart repair




Damage 3: Door - front right side: Door edge - Scratch(es) - Smart repair




Damage 4: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 4: Door - front left side: Door edge - Scratch(es) - Smart repair

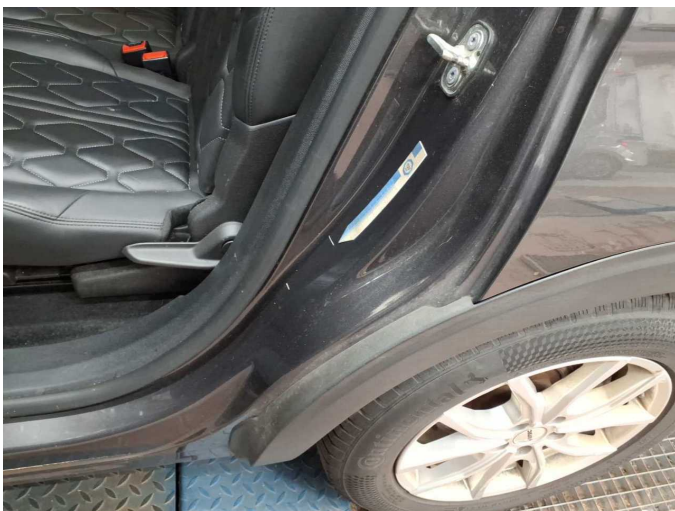

Damage 5: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair

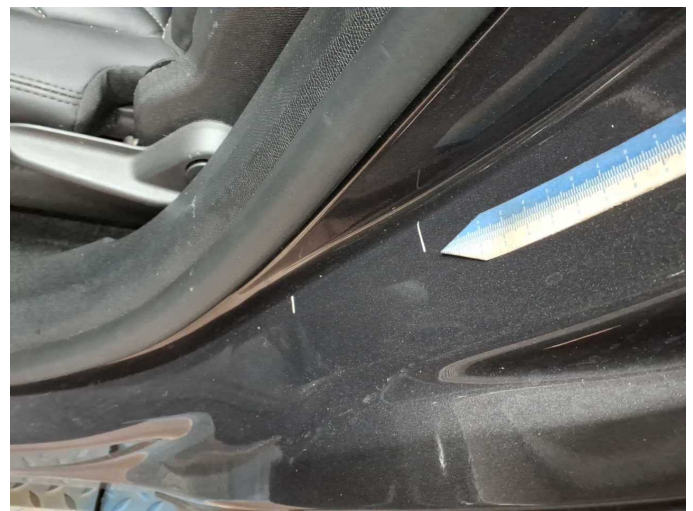

Damage 5: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair




Damage 5: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair




Damage 6: Door - rear left side: Door - Dent / paintcoat damage - Smart repair




Damage 6: Door - rear left side: Door - Dent / paintcoat damage - Smart repair

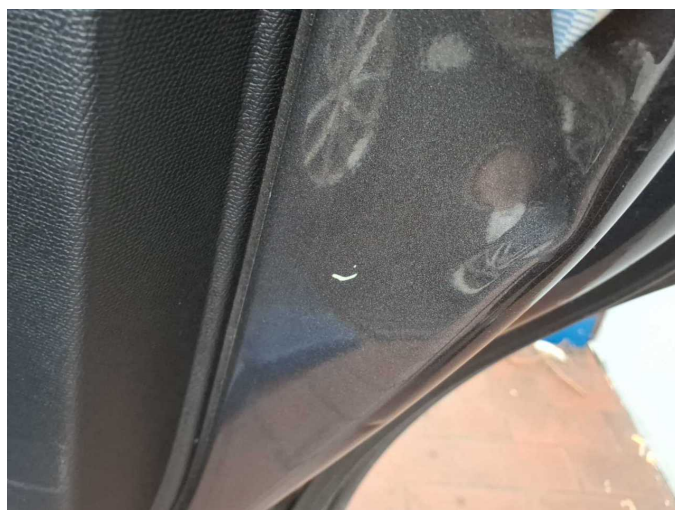

Damage 6: Door - rear left side: Door - Dent / paintcoat damage - Smart repair

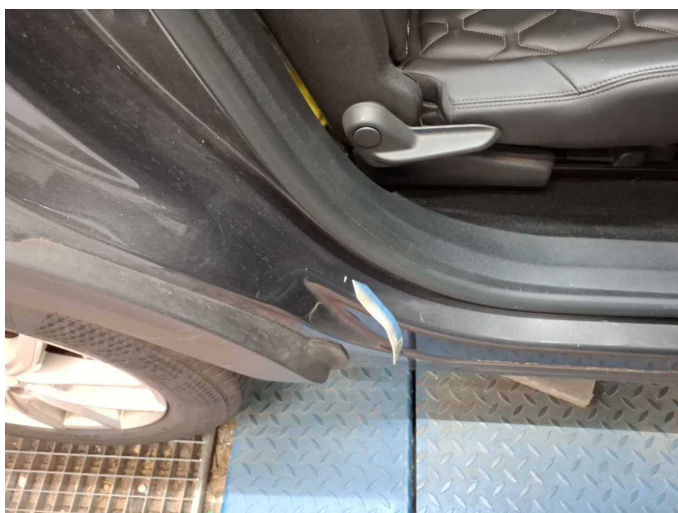

Damage 7: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair

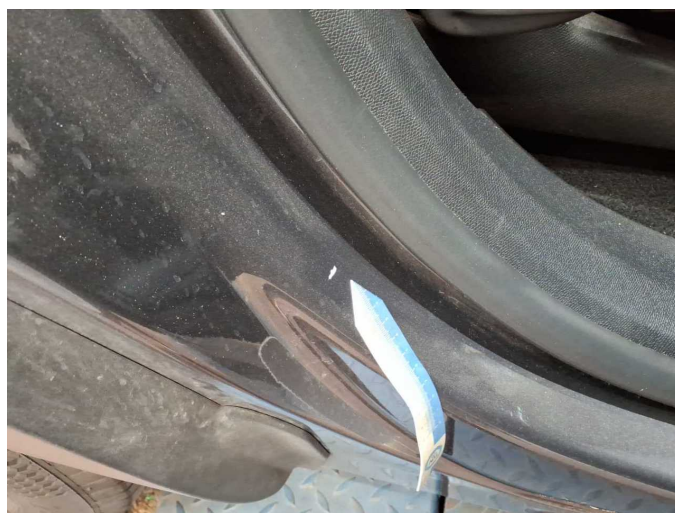

Damage 7: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 7: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 7: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 7: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 8: Interior: Interior - Scratched - Loss in value



Damage 8: Interior: Interior - Scratched - Loss in value



Damage 8: Interior: Interior - Scratched - Loss in value



Damage 8: Interior: Interior - Scratched - Loss in value



Damage 8: Interior: Interior - Scratched - Loss in value



Damage 8: Interior: Interior - Scratched - Loss in value



Damage 8: Interior: Interior - Scratched - Loss in value



Damage 9: Front bumper: Front strip - Broken / torn - Replace



Damage 9: Front bumper: Front strip - Broken / torn - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: VF3MJEHZUNS183710
Hersteller / Modell: PEUGEOT PEUGEOT 5008 BlueHDi 180 EAT8 GT Pack

Datum	KM-Stand	Beschreibung
10.03.2026	157.846	Batterie ern
02.02.2026	152.524	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/ Eigendiagnose; Wartung Sonstiges; Zahnriemen/Steuerkett ern
30.10.2025	136.215	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne
08.10.2025	132.987	Systemtest/Eigendiagnose
22.07.2025	122.569	Bremsflüssigkeit; Bremsflüssigkeit ern; Keilrippenriemen; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
17.01.2025	91.840	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
05.11.2024	77.410	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten
30.07.2024	62.232	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
13.12.2023	31.723	Bremse Sonstiges; Bremsklötze hinten; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges